20/20 HOME INSPECTIONS

40 Stockell Crescent

Ajax, Ontario L1T 0M4

Telephone: 416-518-9680

HOME INSPECTION REPORT



Property Address: 1 Woodlee Rd Date of inspection: April 4th 2025

Prepared By:

Pradeep Samaroo, RHI

20/20HOMEINSPECTIONS

40 Stockell Crescent Ajax, Ontario L1T 0M4 T: 416-518-9680 E: pradeep_samaroo@hotmail.com W: www.2020homeinspections.ca

Our Vision is Your Peace of Mind

Residential and Commercial Property Inspections Buyers Home Inspections Inspections for Sellers Prior to Listing Thermal Imaging Inspections of Newly Constructed Homes

20/20HOMEINSPECTION	S
40 Stockell Crescent	Ajax Ontario L1T 0M4
Telephone: 416-518-9680	www.2020homeinspections.ca pradeep_samaroo@hotmail.com
PRE-LIST SUMMARY	
Address: 1 Woodlee Rd	Municipality: Toronto Inspection Date: April 4th 2025
General Information: House	is in good condition Inspector: Pradeep Samaroo, RHI
Age of House 90	years. Construction Type: 2 storey 💌 detached 💌 brick veneer & wood frame upper level 💌
This house is in above avera	age v functional condition in comparison to other similar age and size homes in the neighbourhood.
On average; a house of simila	ar age/size and quality will cost you \$3500-\$4500 💌 for annual general repairs and on-going maintenance.
You will require \$2500	(minimum) to address the functional concerns listed in the the report over the next 0-1 vea
MAJOR SYSTEMS - GEN	ERAL DESCRIPTION AND CONDITIONS:
Roofing systems: flat roof n	nembrane 🔻 Secondary roofing system: asphalt shingles 💌
Exterior wall systems: brick	veneer Secondary wall siding: vinyl siding
Windows(general): Mostly u	updated: vinyl sliders/casements
Electrical Systems	
Main service size 100 🔻 a	mp circuit breakers Predominant branch wiring: romex/copper 🔻
Heating System	
Fuel type: natural gas 🔻 A	Age of central heating appliance: 5 years System type: high-efficiency forced air furnace 💌
Cooling System	
System type: central A/C-lo	w velocity Age of cooling equipment: 15 years Approx. tons: 2 tons 💌
Plumbing System	
Main supply: 3/4 inch coppe	er line
Interior (general): interior el	ements have been substantially updated
HOMEOWNER INSURAN	ICE CONCERNS
✓ None Identified	
REOUIRED REPAIRS/MA	AJOR SYSTEMS AND COMPONENTS APPROACHING END OF EXPECTED LIFE SPAN
Repair treads on staircase	▼ Time frame 0-1 ▼ years Budget \$ 1000
	▼ Time frame ▼ years Budget \$
Repair leak in hot water tank	
Miscellaneous exterior repair	
	Time frame years Budget \$
	Time frame vears Budget \$
OTHER RECOMMENDA	TIONS
The settlement on the 2nd flo	oor though not active and is not uncommon in older homes should be reviewed
by a professional	▼
	▼
ADDITIONAL INFORMA	TION REQUIRED
SUMMARV	

SUMMARY

This report should not be considered as a complete home and property inspection. The 20/20 Home Inspections report is prepared for the owner to provide general information about this property. The inspector is available by telephone to any interested party to answer questions about the house. Please read the full report prior to calling the inspector. We are also available to provide any prospective buyer general orientation, helpful maintenance tips and improvement consulting for a fee. This general review inspection is essential to compare your expectations, intended use and special needs with the realities of the house.

Interested parties should be advised that without this general review our obligation and liability can only remain with the seller.

20/20HOMEINSPECTIONS

20/20HOMEINSPECTION	13					
40 Stockell Crescent Aj	ax Ontario L	IT 0M4				
Telephone: 416-518-9680		www.202	Ohomeinspections.cs	a pradeep_sa	amaroo@hotmail.com	
PRELIMINARY BUILDIN	IG INSPECTI	ON REPOI	RT			
Property Inspected 1 Wood					Municipality Toronto	-
Inspection Date April 4th 20)25		Time 1:30		Inspector Pradeep Samaroo, RHI	-
SUMMARY (GENERAL C						
-		-	-		ing/dwelling is; above average.	
Recommended improvement				ddressed in the report.		
It is suggested that the highli	-		-			
Please be advised that failu	re to address o	concerns pr	omptly may result in	n additional problems	s and/or consequential damages.	
	MINOR	MAJOR		MINOR	MAJOR	
	REPAIRS	REPAIRS		REPAIRS	REPAIRS	
Roofing			Structure			
Exteriors	P		Electrical	*		
Interiors	P		Heat/Cool	P		
Maintenance	*		Plumbing			
Comments:			ļ			
					care. This consulting service is limited to the	
 The inspector's role is p The preliminary inspect The inspector/inspection The client is advised to The client is warned that report are not carried out Cost estimates if provid 	orincipally educ ion is partially n firm will not a annually budge at resultant dam at in a timely m ed in this repor	eational; to p designed to assume any o et at least 1% ages may oc anner. This i t are minimu	rovide you with a bet reduce your risk of b of your risk in buying of the building's val ocur to the building sy is especially the case ums and are intended	ter understanding of the uying an older home. F g an older property. Fur use for general mainten ystems or components in in matters concerning use to be a rough guideling	ontaminants are specifically not included. the building. We will not detect all problems. However we cannot eliminate this risk. ther inspections by specialists are required. ance and unforeseen repairs. if the recommended repairs in this uncontrolled water/vapour. the only. Estimates are based on the urate cost estimates from contractors immedia	ately.
 The preliminary inspect 		-				5
					mortgage insurance, building or homeowner	s insuranc
					his report is not provided as an aid for negotia	
	-		-		is report is not provided as all ald for negotia	011
in a real estate transaction			-			
11) The purchaser is advise	d to ask the pro	perty owner	if they are aware of a	any defects that would	not normally be detected by a visual inspection	on.
The purchaser is advise	d to revisit the	property bef	ore closing to verify t	that functional condition	ns remain unchanged or retain the inspector	for this tas
12) The client hereby acknow	wledges they a	re contractu	ally obliged to contac	t the inspector immedi	ately to arrange a site visit at no	
extra expense in the eve	ent of an unfore	seen and/or	unreported problem o	or upon receiving a con	flicting opinion and prior to any corrective w	ork.
-					I accept this report and supplements acco	
	-				nal time and is not a guarantee of present	0
				-	or to re-evaluate the property prior to clos	
evidence of new water leak	s and/or items	not previou	sly inspected due to	seasonal limitations	for an additional fee.	
Name of Client				(Bus.)	(Res.)	
Current Address				Other		

Copyright CBCG 2016 - Licensed to Pradeep Samaroo until November 15, 2025

E-mail:

GENERAL CONDITIONS/SPECIAL SITUATIONS & LIMITATIONS

GENERAL CONDITIONS/S	I ECIAL SITUATIONS & LIMITATIONS
The primary purpose of the insp	pection and report is to educate the prospective purchaser/owner about the general condition of the building.
Repair and cost effective impro	vement advice is provided to increase this understanding. It is not a contractual obligation nor is it possible for the
	al problems solely on the basis of a visual examination. 80% of first year repairs should be revealed: not 100%.
DEFINITION OF TERMS US	SED IN THE PRELIMINARY INSPECTION REPORT:
Functional	(1) system was performing its' intended purpose at the time of the inspection, no significant loss of functionality
Monitor and/or Maintenance	(1) item is marginal; will require future repair or replacement. Owner is advised to monitor.
	(2) preventative maintenance repairs are required by property owner.
Minor Repair	(1) minor repair is recommended; cost should not exceed \$3000.00 and/or repair is not urgent.
Major Repair	(1) major repair is recommended; cost will exceed \$3000.00. Obtain contractor's estimates immediately.
Good Condition	(1) no defects were discovered that should require repair within the first six months, no significant loss of functionality
	Note: Limitations of a visual inspection and visually accessible physical evidence are in effect.
Fair Condition	(1) system or component is performing its intended purpose; but due to its age can fail at any time.
N/A	(1) not applicable/not accessible/not inspected/not installed or does not pertain to the subject property.
(?)	(1) performance/future performance of system or component is unpredictable. Further review is required.
	g the summary portion of the inspection is to discuss the significant aspects of their findings. There is no time limit
on these discussions. Ask as ma	any questions as you like to ensure we have addressed your concerns. The inspection process is a two-part system:
	t. This report is not transferable to third parties as it will not clearly convey the information herein.
WEATHER CONDITIONS	
Snow/ rain/	limited the extent of the exterior inspection. Roof/ grade/ walkway/ decks were snow covered.
	infall limited scope of basement foundation inspection.
	as too low to safely test the air conditioning system(s)/distribution systems and summer comfort.
The outdoor temperature wa	as too high to sufficiently test the central heating system/distribution systems and winter comfort.
Weather conditions during in	spection: Rainy Snow Clear Cloudy Windy Temperature 5C to 10C
_	limited access/ visibility. 🗹 Excessive storage limited access to: rear basement
	ogress not fully visually inspected:
Other specific limitations:	
Plumbing system winterized	
Building substantially furnitian	shed 🗹 Building occupied 🔲 Buildingvacant/ partially 🔲 Building unoccupied 📃
RENOVATIONS/REMODEI	
	hed in this report are based on the intent of the client that upgrades will be done to the following:
Exterior Addition	
GENERAL/ORIENTATION	
For reference purposes the f	
Seller has warranted the fol	
Further inquiries to seller is	
TYPE OF INSPECTION/TR	
	Pre-sale inspection Newly built house inspection Post-purchase inspection
Home owners inspection	Estate sale Power of sale Private sale Pre-lease/rental inspection Pre-offer inspection
ATTENDANCE	
Buyer/client not present at i	
Also in attendance: 🗹 Seller	Seller's agent Buyer's agent
EXCLUSIONS	
	bols & related equipment is beyond the scope of our visual inspections.
	are the responsibility of the the condominium corporations. Review particulars with legal counsel.
Appliances/central vacuum	systems/trees/heat exchangers/flue interiors/outbuildings/security system/intercom/spas/wood destroying insects/vermin

and animals/underground storage tanks/sub-grade plumbing drains/environmental testing/UFFI/mold and other indoor air quality contaminants/ window air conditioners/asbestos containing material/septic tanks/wells/marine structures and other items not specifically mentioned in the report are not included within the scope of this inspection. We do not disassemble equipment/bore holes into walls/floors and ceilings/move furniture and boxes/lift up carpets.

COST ALLOWANCES/TIME FRAMES AND SHORT TERM COURSE OF ACTION YOUR EXPECTATION LEVEL

We have included this summary to help you prepare and budget for future work. Please be cautioned that the following noted items represent the minimum amount of work that you will address in the future. Be aware that you may receive opinions from other tradespeople or knowledgeable parties that can vary drastically from our own. In this instance we require you to contact us immediately to seek clarification or request a site inspection at no further expense.

GENERAL CONDITION AT THE TIME OF THE PRELIMINARY INSPECTION

Z The subject property requires less current repair consideration than the average house/building of similar vintage

The subject property requires an average amount of repair consideration compared with other houses/buildings of similar vintage.

The subject property requires more current repair consideration than the average house/building of similar vintage.

The average annual repair/maintenance budget for a home/building of similar size and vintage is: \$3500-\$4500					
YOUR MINIMUM	BUDGET ALLOWAN	CE:			
\checkmark over the first 0 -	2 years over the fir	st 0 - 5 Years \Box over the co	urse of		
To address the fund	ctional concerns listed b	elow you must budget at the v	very least the follow	ving amount:	
\$2000-\$5000	\$5000-\$10000	10000-\$15000 🔲 \$15000-\$2	20000		
AREAS REQUIRI	NG CONSIDERATION				
Roofing Systems:	Roof Coverings	Eavestroughs/down pipes	Overhangs	Chimneys/flashings	Skylights
Exterior:	Brick/sidings/walls	Windows/doors	Site drainage	Porches/decks	Painting
	Garage/sheds	Driveway/walkway	Landscaping	Fencing/gates	
Structures:	Crawlspaces	Beams/columns	Floors	Even Foundation wall	
Electrical Systems:	Main service/panels	Lighting fixtures/switches	Branch wiring	Receptacles/outlets	
Heat/Cool Systems:	Furnace/boiler	Distribution: ducts/rads	AC system	Filters/humidifiers	
Plumbing Systems	Main water service	Distribution piping	Drains/vents	Fixtures/fittings	
² Interiors:	Kitchen	Basement spaces	Bathrooms	Attic/roof spaces	Fireplaces
	Walls/ceilings	Floor coverings	✓ Stairs/railings	Appliances	Decorating
	P 1		1		

General annual & seasonal exterior/interior building maintenance & small repairs

YOUR RECOMMENDED COURSE OF IMMEDIATE ACTION:

Please review the preliminary report in its entirety and ask for clarification on any matter. This page must not be relied upon in isolation. Prior to continuing with the next step of the transaction/project consider the issues listed in the report. We advise you to consult with your realtor or lawyer regarding options on how to proceed. Also instruct your lawyer to obtain Title Insurance for you. You should request additional inspections as outlined in the full report to address your special concerns and/or matters that we can not inspect. You must also factor the limitations of the building inspection in your decision making process. 80% of first year repairs should be revealed: NOT 100%. Therefore you must anticipate and budget for the 20% unforeseen deficiencies that will not be discovered by a visual inspection. You must ask the seller for invoices/applicable warranties/plans and/or permits for work completed in the last five years.

See survey summary on preceding page for priorities and costs.	-		
Further clarification regarding:			
	is required of the:		-
	is required of the:		-
Further inspection/evaluation is required regarding:			
The settlement the 2nd floor though not active and is not uncommon in of	lder homes should be	•	
		-	
		-	


☑ OBTAIN CONTRACTORS QUOTES/REPAIR SPECIFICATIONS ON ANY MAJOR REPAIR NOTED HEREIN IMMEDIATELY.

	1/2-Yr. Priority Ke	y ROOF STRUCTURES COVERINGS & RELATED SYSTEMS		
	Maj Min N/A Mor Funç	METHOD OF ROOF INSPECTION		
Function Function Fully accessed (walked on) At eaves At ground with binoculars (too steep/ inaccessible) Note: (limitations LIMITATIONS				
	Ë, Ë,	 Majority of the above elements were snow/ ice/ frost covered. Flat roof is covered with gravel/ decking Due to the unpredictable and latent nature of roof leaks no assurances or warranty can be provided that your roof will not 		
		leak within the approximated expected lifespan stated in this report. Ice damming problems are beyond our ability to predict. ROOF COVERINGS TYPE		
		Asphalt shingles are the principal roof covering of the building.		
		Asphalt shingles cover all sloping roof surfaces of the building.		
		covers the principal flat roof surfaces of the building.		
		is the principal roof covering of the building.		
		covers the roof surface at the		
		Drone used to inspect the roof		
		ROOF COVERINGS CONDITION (where visible)		
		Estimated remaining lifespan of roof shingles/coverings: NOTE: Estimated lifespan based on visible portion of roof only.		
		Flat = 15 years ?		
		$\frac{\text{Shingles}}{2} = \frac{15}{2} \text{ years } ?$		
		General condition of flat roof coverings: ☑ Good □ Fair □ Poor □ ?		
		Current repair is required at:		
		Roof covering replacement is required at:		
		High probability of replacement of roof coverings within years. Repairs/ roofing tune-up is required soon/ before next application of roof coverings Annual visual inspection required.		
		Trim tree branches/ vines away from roof edge.		
Copyright CBCG 2016				
right		ROOF/WALL FLASHINGS & JOINTS (where visible)		
CBC		All/most flashings are in Good condition Fair condition		
G 2(Repair/ replace/ install flashings at:		
)16 -		Repair/ replace all flashings with next roof covering replacement. Caulking rec'd at:		
Lice		Repairs/ maintenance required before next application of roof coverings: (ie) caulking or tarring		
nsed		ROOF DRAINAGE		
to Pr		Type: Aluminum Galvanized steel Plastic Copper Lead Hoppers/Scuppers		
adee		Roof drainage is in: Good condition Fair condition Seasonal cleaning required		
p Sar		Gutters Downpipes/ drains require repair/ extending/ painting at: North east corner- connect downspout to gutter		
naroo		Extend downpipe from upper level roof directly into lower gutter/ eavestrough. Repair loose gutters; nails.		
Licensed to Pradeep Samaroo until November 15, 2025		Extend/ relocate downpipe(s) at corner/ side 4'-6' away from building Add drainage pads		
l No		Replacement/ Installation of gutters/ downpipes recommended at:		
vemb		Gutters & downpipes are approaching end of functional life. Caulking at leaky joints required.		
er 15		SOFFIT AND FASCIA		
, 202		Type: Aluminum Plywood Vinyl		
5		Soffit & fascia are in: ☐ Good condition ☐ Fair condition Fair conditio		
		Repairs are required/ recommended at:		
		Replacement/ new aluminum cladding of soffit/ fascia is recommended in future.		
		SKYLIGHTS ROOF WINDOWS & SOLARIUMS		
		Type: Factory built Home-made (usually of sub-standard quality)		
		Units are in: Good condition Fair condition Evidence of leakage at:		
		Annual maintenance/ caulking recommended. Repair/ replace:		

See Additional Comment Page

1/2-Yr. Priority Ke	Y EXTERIOR (GEN	ERAL CONDITION	S)			
Maj Min N/A Mor	Approximate age of building i	s 90 years. Building h	as been substantially renovated	l years ago.	N/A	
Major Repair Minor Repair N/A Monitor Functional	TYPE OF STRUCTURE	CONSTRUCTION TYPE	OCCUPANCY TYPE			
epair epair al	✓ Detached	✓ Wood frame	Single family dwelling	Duplex		
	Semi-detached	Brick veneer	Basement apt. added	Triplex		
	Row house/fully attached	Solid masonry	Multi-purpose occupancy	Every Fourplex		
	Condominium/townhouse	Wood frame-upper level		Multiplex		
		Brick front only				
	EXTERIOR WALLS/WALI	-				
	Brick/Masonry (inspected at	grade level)				
	Masonry units & mortar ar	e in: 🗹 Good condition	Fair general condition.			
	Mortar repair; tuck point re	ecommended at:				
	Brick repair required at:					
	Non-structural cracks note	d which could/ should be re	epaired. 🔲 Repair sills at:			
	Wall sidings (inspected at gr	ade level)				
	Type: Aluminum V	•			Stucco/ EIFS	
	Good condition Fair	general condition. 📃 Repa	ir required/ recommended at:			
	New wall coverings/ re-cla	adding recommended at:				
	Application of protective c Caulking/minor repairs at		nmended to most/ all wood/ ot	her surfaces.		
	Foundation Wall (above grad	de)				
	. –	Good condition 🔲 Fair con	ndition 🔲 Non-structural cra	cks noted		
	Requires tuck pointing at:					
	Requires parging/ repair a	t:				
	Chimneys					
	Type: Masonry Masonry	etal 🔲 Side wall venting	None required			
	Good condition Fair	condition 🔲 Requires repa	ir/ tuck pointing 🔲 Flue cap	recommended		
	Requires new chimney cap	o/ drip edge 🔲 Requires re	building/extending 🔲 Remo	ove obsolete chimney		
	Exterior Doors					
	Exterior doors at:	t 📃 Side 🗹 Rear are in	E: 🗹 Good condition 🔲 Fa	air condition		
	Repair/ replace:					
	Install storm/ screen door			place hardware at:		
	Upgrade/ caulking/ paintin	g 🔲 Upgrade weather strip	pping Upgrade locks at:			
	Windows (General)				.	
	Material Type: Alumina			zontal sliding	Wood/ aluminum storms	
	-	ngle/Double-hung 🗹 Case				
			- 10 01	ing		
	Storm/ screen systems are					
	Repair/ replace window fi					
	Window refurbishing/ repl					
	GRADING/SITE DRAINAGE/RETAINING WALLS Good condition Fair grading conditions exist alongside the foundation(s) of the building.					
	Grading conditions require i			utio/ walkway slopes t	oward wall	
		-	ondition	ulo/ walkway slopes i		
	Retaining walls require re					
		Good condition 🔲 Fair con	dition			
	Window well repair/ instal					
	See Additional Comment I					


1/2-Yr. Priority Ke	EXTERIOR (GENERAL CONDITION) continued
Maj Min N/A Mor	GARAGE/OUTBUILDING/CARPORT
Major Rep Minor Rep N/A Monitor Functional	Attached Garage Good condition Fair condition Poor condition
Major Repair Minor Repair N/A Monitor Functional	Gas proofing measures of common walls with house required; provide gas seal. Repair holes in walls/ cellings.
	🗌 Entry door into dwelling requires self-closing device /repair self-closure. 🔲 Weather stripping/ caulking required to door/ frame.
	Detached Garage Good condition Fair condition Poor condition/ Remove
	Structure type: Wood Frame Solid Masonry Brick Veneer Repairs to walls required
	Roof Coverings
	Good condition Fair condition Replace roof coverings soon Eavestroughs recommended/ repair/ install
	Caution: Underground/ overhead wires supplying power to garage/ shed. Electrical power to garage is recommended
	Overhead Door Operation Good condition Fair condition Requires repair/ replacement/ painting
	Automatic Door Operation Install dedicated receptacle for garage door opener; avoid extension cord use.
	Good condition Fair condition Requires repair/ replacement Adjust/ no auto-reverse
	WALKWAYS/DRIVEWAYS
	Good condition Fair condition Replacement of driveway/ walkway recommended.
	Repair work required/ recommended at:
	PORCHES/DECKS/BALCONIES (egress to exterior) Location: Front ▼ Type: ✓ wood masonry concrete steel unable to access under deck
	Structural supports: 🗹 Good condition 🗌 Fair condition
	Decking: Good condition Fair condition
	Steps/stairs: Good condition Fair condition
	Guards/handrails: Good condition Fair condition Guardrails low/ spacing unsafe/ repair/ missing
	Location: Type: wood masonry concrete steel unable to access under deck
	Structural supports: Good condition Fair condition
	Decking: Good condition Fair condition
	Steps/stairs: Good condition Fair condition
	Guards/handrails: Good condition Fair condition Guardrails low/ spacing unsafe/ repair/ missing
	Handrail/guardrail recommended alongside steps at:
	EXTERIOR PLUMBING CONDITIONS Winterized/ could not test.
	Garden hose connection location: Front Rear Side Garage None
	Good condition Fair condition Repair/ replace at:
	Main vent stack(s)
	Good condition Requires repair/ extending from roof
	Good clearance from windows/ doors No evidence of vent stack for plumbing system visible.
	EXTERIOR ELECTRICAL CONDITIONS
	Exterior plug receptacle location: Front Rear Side Garage
	Good condition Fair condition Requires weatherproof cover Receptacle not grounded
	Requires repair/ replacement at:
	All/most exterior receptacles are required to be replaced with GFCI type. Rework exposed cabling at exterior walls
	Lighting location: 🗹 Main entrance 🗌 Side entrance 🔽 Rear entrance 🔲 Garage
	Fixture(s) are in: 🗹 Good condition 🗌 Fair condition
	Repair/ replace at:
	Service entrance: (electrical cables feeding house from street transformer)
	✓ Overhead entrance Underground/lateral entrance
	✓ Mast head conduits/ meter base properly affixed to building.

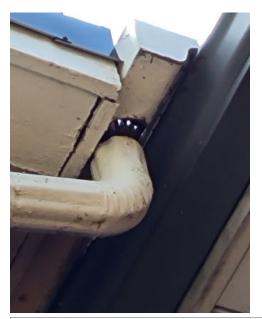

gutter is not connected to the downspout



Rear fence is in need of repair

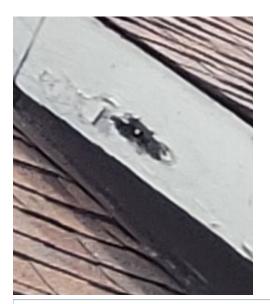

1/2-Yr. Priority Ke	FOUNDATIONS BASEMENTS & STRUCTURES
Maj Min N/A Mon	LIMITATIONS:
Major Repair Minor Repair N/A Monitor Functional	Substantially/partially finished basement/ crawlspace limited observations.
	Due to the unpredictable and latent nature of basement leaks no assurances or warranty can be provided that your basement will not leak
г г	in the future. We caution you that it is common for basement leaks to develop at any time in the future where no such leaks existed in the past
	We cannot detect previous leaking or predict future leaking.
	We are unable to detect existence or type of mold at interior space. Further investigation is recommened.
	FOUNDATION CONSTRUCTION TYPE
	Continuous foundation Masonry/ wood piers Slab on grade Wood beam on grade
	ACCESS/BASEMENT TYPE
	✓ Full basement Crawlspace Basement & crawlspace combination Crawlspace fully/ partially accessed
	Crawlspace is interconnected with adjacent dwelling
	FOUNDATION MATERIAL TYPE
	Brick Stone Concrete block Poured concrete Preserved wood foundation
	Foundation wall interiors not accessible for visual inspection.
	Non-structural cracks were observed which could be a source of future water penetration.
	EXTENSION/ADDITION at the supported with a different foundation type than the main building.
	Continuous concrete Masonry/ wood piers Slab on grade Wood beam on grade
	Crawlspace Full basement No visible accessibility Access to crawlspace is recommended.
	Repairs/ improvements are required at:
	INTERIOR COLUMNS & BEAMS/INTERIOR LOAD SUPPORTS (BASEMENT LEVEL)
	Columns & Walls: Wood Steel 🗹 Masonry Not visible
	Beams: 🗹 Wood 🔲 Steel 🔲 Paralam/ Engineered wood 🔲 Not visible
	Support system members are in: Good condition where visible Fair condition where visible
	Repairs to support load are required at:
	FLOOR (BASEMENT)
	Concrete Finished (covered; limited observations) Good condition Fair condition
	Unfinished/exposed soil Raised wood(limited observations) Removal of raised wood sub-floor is recommended.
	FLOOR JOISTS/FLOOR SYSTEM Type (floor & ceiling joists where visible)
	✓ Wood joists
	Floor system appears to be in: Good condition where visible Fair condition where visible
	Some localized repairs/ defects Repair/ replace floor joists at:
	BASEMENT WINDOWS/VENTILATION & INSULATION
	Good ventilation Fair natural ventilation supplied to basement/ crawlspace.
	Replacement/ upgrade of all/ some basement windows are recommended.
	Supply ventilation to: Weather strip cold storage room door.
	Insulation recommended at:
	WATER SEEPAGE/PENETRATION (visible condition only with use of moisture meter)
	NOTE: A mold/IAQ inspection is recommended in the event of active water leaks/dampness or high humidity levels.
	No visual evidence of active water penetration through foundation walls. (limitations of visual inspection are in effect)
	Dampness/ efflorescence noted on foundation walls. Dampness/ moisture observed at cold storage room.
	Active leaking/seeping observed through foundation walls at:
	Possible major damage to interior finishes as result of ongoing/ previous leaks and moisture. Further review recommended.
	Previous leaking/ seeping which measured dry observed through foundation walls at:
	All areas of foundation walls not thoroughly inspected due to finished wall coverings and storage of material/etc.
	See Additional Comment Page

1/2-Yr. Priority Ke	EV ELECTRICAL SYSTEM
Maj Min N/A Mon	LIMITATIONS:
Major Repair Minor Repair N/A Monitor Functional	Ratio/ percentage of different wiring types are minimums (if provided). Further review by a licensed electrician is required.
epair al	We cannot detect existence of knob & tube wiring behind walls and within junction boxes/outlet boxes.
	Access to main panel is restricted. Could not visually access or open main panel.
	Auxiliary systems not inspected: back-up generators, solar & battery power, low-voltage lighting, pool and spa systems.
	MAIN ELECTRICAL STATION
	Main disconnect rating: 60A ✓ 100A 125A 200A 400A ▲
	Main panel service rating: 60A 🗹 100A 🗌 125A 🗌 200A 🗌 400A 🔲 🛛 A
	Main power disconnect type: Circuit breaker 🔲 Knife switch/cartridge fuse
	Supply voltage: 120V 🗹 120V/240V 🛄 347V/600V Service entrance conductors: 🗌 Cu 🛄 Al 🗹 Notvisible
	Grounding conductor: 🗹 Good condition 🔲 Not Determined 🔲 Requires repair/replacement
	Location of main and distribution panels: 🗹 Basement 🔄 Garage 🔛 Attic 🔛 Shed 🗔
	Location of auxiliary distribution panels: Basement Garage Attic Shed
	Condition of main/auxiliary panels: 🗹 Good condition 🗌 Fair condition
	Adequate 💌 sized main distribution panel is installed. 🗌 Labelling of branch circuit panels is recommended.
	Adequate v number of circuits are available to properly distribute intended load.
	distribution panel(s) are recommended(for future use).
	🗹 Spare circuits available at distribution panel: Yes 🧹 🔲 No spare circuits are available. Auxiliary panel is recommended.
	Double tapping noted at some circuits Possible overloaded circuit situation. Monitor.
	DISTRIBUTION Note: Determining branch wiring types is limited to visual inspection only.
	Predominant visible branch wiring type:
	Knob & tube (old copper)%? \checkmark Romex (conventional copper)%?
	BX (metallic sheathed) % ? Aluminum % ? Ungrounded older romex % ?
	Note: Aluminum wiring is the original/principal branch wire type. 🔲 No unsafe conditions identified with outlets tested.
	BRANCH CIRCUITS OVERCURRENT PROTECTION:
	At main distribution panel(s): Glass fuses Cartridge fuses 🗹 Breakers
	At auxiliary panel(s): Glass fuses Cartridge fuses 🗹 Breakers
	Fuses/breakers
	Properly sized fuses/ breakers are presently used to protect branch circuits.
	Arc fault circuit interrupters (A.F.C.I) are recommended to be installed at panel to protect bedrooms/convenience receptacles.
	General
	Good v lighting source is provided to all habitable areas & service rooms.
	Additional lighting recommended at:
	Good v number of receptacles is provided to all habitable areas & service rooms.
	Additional receptacles recommended at:
	REPAIR/UPGRADING RECOMMENDATIONS Upgrade amperage of main service to: 100 AMPS 200 AMPS presently or upon the next home improvement undertaken.
	Upgrade amperage of main service to: 100 AMPS 200 AMPS presently or upon the next home improvement undertaken. Most/ some convenience receptacles in dwelling do not have secondary ground (i.e. 2 prong); add GFCI receptacles.
	Rework poor wiring connections at: Basement Garage Attic Panel
	Repair/replace lighting fixtures/ switches/ ceiling fans at:
	Repair/ replace receptacles at
	Missing coverplates/ loose outlets/ exposed cabling observed at:
	Installation/maintenance of smoke/CO alarms at all floor levels of the building/dwelling is required.
	\blacksquare Installation/ maintenance of smoke/CO atarms at all noor levels of the building/dweining is required. \blacksquare A.r.C.i. recommended/bedrooms. \blacksquare G.F.C.I. receptacles are req'd at: \blacksquare kitchen counter \blacksquare exterior \blacksquare garage/ outbuilding \blacksquare bathrooms \blacksquare spa/ whirlpool bath
	Receptacle at rear fence is not gfci protected.
	See Additional Comment Page

	See	Additional	Comment	Pag
--	-----	------------	---------	-----

1/2-Yr. Priority Ke	y CENTRAL HEATING SYSTEM-FURNACE/FORCED AIR SYSTEMS
Maj Min N/A Mor	LIMITATIONS
Major Rep Minor Rep N/A Monitor Functional	✓ Determining winter comfort with specific areas is beyond the scope of a visual inspection.
Major Repair Minor Repair N/A Monitor Functional	The heat exchanger is concealed within the furnace and cannot be reviewed.
- · ·	The outdoor temperature was too high to sufficiently review the heating system/ductwork and winter comfort.
	GENERAL COMMENTS
	Energy source: Oil Gas Electric B.T.U rating 70K
	Furnace type: 🔲 conventional warm air furnace 🔛 mid-efficiency warm air furnace 📝 high-efficiency warm air furnace
	HWT/Combo system Commercial roof top unit Ground source heat pump Fan/coil unit
	Approximate age of furnace 1 = 5 years. Approximate age of furnace 2 = years.
	Probability of furnace 1 replacement within the next 10 years high Medium I Low ?
	Probability of furnace 2 replacement within the next years high Medium 2 Low ?
	Chimney flue interior: Clay lined Metal lined Brick lined I Direct vent Metal lining of flue required.
	Furnace room ventilation: Good Fair
	Thermostat condition: 🗹 Good 🔲 Requires replacement Thermostat location: 🔲 Good 🔲 Requires relocation
	Heat source supplied to habitable areas/zones
	Basement: ✓ Yes No Main floor: ✓ Yes No 2nd floor: ✓ Yes No 3rd floor: ✓ Yes No
	Habitable room(s) not provided with a heat source:
	WARM AIR SYSTEM-FURNACE Good overall condition Fair overall condition CO emission test required.
	Drive/motor operation: 🗹 Good 🔲 Fair 🔲 Requires repair/ replacement
	Clean air/filtration system: Good Fair Requires repair/ replacement/ upgrade
	Central humidifier operation: Good Fair Requires repair/ replacement/ removal/ upgrade
	Burner(s)/coil condition: 🗹 Good 🔲 Fair 🔲 Requires repair/ replacement
	Limit and operating controls 🗹 Good 🔲 Fair 🔲 Requires repair/ replacement
	Venting condition: Good Fair Requires repair/ replacement
	Annual servicing and cleaning recommended. Heating company insurance plan recommended. Air duct cleaning is recommended.
	Carbon monoxide (CO) detector is required.(all levels) TSSA inspection tag missing. Further review required.
	DISTRIBUTION SYSTEM - AIR DUCT SYSTEM
	Condition of supply plenum: 🗹 Good 🗌 Fair 🔲 Requires repair
	Condition of return plenum: 🗹 Good 🗌 Fair 🗌 Requires repair
	Condition of branch ducts: 🖉 Good 🔲 Fair 🔲 Requires repair
	Condition of register/grilles: 🗹 Good 🗌 Fair 🔲 Requires repair
	Condition of return ducts/inlets: 🗹 Good 🗌 Fair 🔲 Requires repair
	Air flow at supply outlets: 🖉 Good 🗌 Fair 🔲 Requires repair
	HEATING FUEL STORAGE DISTRIBUTION SYSTEMS
	✓ Location of gas shut off/ gas meter/oil tank valve: front
	Good condition Paint exterior gas piping Requires repair/ replacement
	SUPPLEMENTARY HEATING (Cannot substantiate effectiveness of in-floor heating due to the limitations of a visual inspection)
	Electric heaters/ space heaters/ in-floor heat have been installed at the following areas:
	Supplementary heating is recommended at the following areas:
	Rooms above unheated space: garages: crawlspaces:
	NOTE: These rooms may be slightly cooler than other areas of the house during cold winter days.

Copyright CBCG 2016 - Licensed to Pradeep Samaroo until November 15, 2025

1/2-Yr. Priority Ke	y CENTRAL AIR CONDITIONING SYSTEM
Maj Min N/A Mon	LIMITATIONS
Major Rep Minor Rep N/A Monitor Functional	Due to the unpredictable nature of air conditioner failures no opinion can be given to system life expectancy or future performance.
Major Repair Minor Repair N/A Monitor Functional	Data plate was missing/ not legible; limited inspection. 🔲 Winterized/covered could not review.
	Solariums/ skylight vaults/ lofts/3rd floor levels are difficult to cool. Supplementary cooling may be required.
	I The outdoor temperature was too low to safely activate the air conditioning system. Review prior to transaction closing
	GENERAL INFORMATION
	Energy source: 🗹 Electric 🔲 Gas 🔲 Combination system
	System type: 🗹 Split system 🔲 Integral system 🔛 Heat pump 🔛 Condominium supply/fan coil unit
	Type: Air to Air Ground source Ductless system Roof mounted Interior water cooled
	Approximate estimated cooling capacity of system #1 B.T.U.'s or 2 v tons ?
	Approximate age of cooling system #1 15 2 ?
	Approximate estimated cooling capacity of system #2 B.T.U.'s or votices tons ?
	Approximate age of cooling system #2 ?
	EXTERIOR EQUIPMENT (FOR SPLIT SYSTEMS ONLY)
	Clear of shrubs or plant growth: 🗹 Yes 🗌 No Unit properly mounted(level) on solid base. 🗌 Yes 🗌 No
	Unit properly positioned out of direct sunlight: 🗹 Yes 📃 No
	Electrical connections satisfactory: 🗹 Yes 📃 No
	Condition of condenser fins: 🗹 Good 🔲 Fair 🔛 Cleaning required
	Condition of insulation of low-pressure refrigerant line (where visibly accessible): 🗹 Good 📃 Fair 📃 Repair required
	INTERIOR EQUIPMENT
	Condition (operation) of condensate line: 🗹 Good 🔲 Fair
	Condition of refrigerant lines: 🗹 Good 🔲 Fair
	Thermostat condition: 🗹 Good condition 🗌 Requires replacement
	Thermostat location: 🗹 Good location 🔲 Requires relocation
	INDEPENDENT SYSTEMS/ATTIC MOUNTED UNITS
	Equipment in well ventilated area: Yes No
	Condition/operation of blower coil: Good Fair
	Proper condensate drain connection: Yes No
	Air duct connections at main unit: Good Fair
	Air filter condition: Good Eair Cleaning/replacement required
	COOLING DISTRIBUTION SYSTEM
	Vsing existing heat ducts (see heat distribution system).
	Condition of air duct system: 🗹 Good condition 🔲 Fair condition 🔲 Seasonal duct balancing required.
	Cooling source supplied to habitable areas/room of:
	Basement 🗹 Yes 🗌 No Main floor 🗹 Yes 🛄 No 2nd floor 🗹 Yes 🛄 No 3rd floor 🗌 Yes 🛄 No
	Rooms with no cooling outlet:
	Functional return-air system on each habitable floor level:
	Basement 🖌 Yes 🗌 No Main floor 🖌 Yes 🛄 No 2nd floor 🛄 Yes 📝 No 3rd floor 🛄 Yes 🛄 No
	Return-air system is recommended at 2nd/ 3rd level to optimize air flow.
	GENERAL CONDITIONS
	 System is functioning abnormally; further analysis is required. Manufacturar: warrantice annear to have expliced on major components, system is in fair everall condition.
	Manufacturers' warranties appear to have expired on major components; system is in fair overall condition.
	System/major components are approaching end of expected functional life. Budget for replacement.
	See Additional Comment Page

1/2-Yr. Priority K	INTERIOR PLUMBING SYSTEM
Majo Mino N/A Mon Funo	LIMITATIONS
Major Rep Minor Rep N/A Monitor Functional	Uisual access to main drain and drains underneath basement floors is restricted. No assurances can be provided regarding proper
Major Repair Minor Repair N/A Monitor Functional	drainage conditions or performance. Sewer back-up is beyond our ability to detect or predict. 🛛 🗹 Camera inspection recommended.
	We are unable to detect/ predict slow leaks in drains and water lines.
	WATER SUPPLY: Municipal Private SEWAGE DISPOSAL: Municipal Private ?
	MAIN SHUT-OFF VALVE/LEVER
	Location: 🗹 Basement front wall
	Good condition Fair condition ? Requires repair/ replacement
	TYPES AND VISIBLE CONDITIONS OF WATER SUPPLY LINES (limitations in effect)
	Predominant type: Copper piping Galvanized steel ? PEX
	Visible condition: Good condition Fair condition
	Removal of all galvanized water lines is required to increase water flow and pressure to a desirable level.
	Water pressure: 🗹 Good water pressure 🔲 Fair water pressure 🔲 Poor water pressure
	Functional flow:
	Good functional flow to 2 fixtures when used simultaneously. Basement fixtures excluded.
	Fair functional flow is evident Poor functional flow is evident Upgrade of main water service is recommended.
	TYPES AND VISIBLE CONDITIONS OF INTERIOR WASTE/DRAIN LINES Predominant type: Cast iron/lead Copper piping ABS/plastic Galvanized steel
	Visible condition: Visible condition Fair condition
	No abnormal drainage conditions were observed with all fixtures.
	Repairs required to vent stacks at:
!	Replace main cast iron stacks and soil lines upon next renovation to house.
	Repairs required to main drain lines at:
	Clogged slow draining fixtures at:
	Improperly installed fixture drains at:
	Improperty instance frame at:
	Fixtures with fair functional drainage that appear to be improperly vented:
	BASEMENT/CRAWLSPACE FLOOR DRAIN (visible conditions)
	Good condition Fair condition Requires repair/ replacement/ cleaning Back water valve recommended
	□ Location not determined □ Floor drain not installed □
	HOT WATER TANK Rental Owned ?
	Energy source: 🗹 Gas 🔄 Oil 🔄 Electric Type: 🗹 Tank 🔄 Tankless 🔄 Combination
:	Hot water tank is in: 🗹 Good condition 🔲 Fair condition 🗹 Requires repair/ replacement 🔲 Old; replace
	Venting condition (gas/oil only): Good/ fair condition Metal lining recommended Metal vent has a hole
	SUMP PUMP/SEWAGE EJECTOR SYSTEMS Could not test/sump dry/inaccessible/too cold outside
	Condition of sump: Good Fair condition Requires repair/ replacement
	Operation of pump: Good Fair condition Requires repair/ replacement
	Condition of pump discharge: 🔲 Good 🔲 Fair condition 📄 Requires repair/ replacement 📄 Add cover to sump pump
	PRIVATE WATER SOURCE INOTE: Limitations of visual inspection is in effect.
	Type: Pond/stream/spring Well Vault/cistern Location
	Operation of pressure tank: Good Fair condition Requires repair/ replacement
	Operation of (well) pump: Good Fair condition Requires repair/ replacement
	PRIVATE SEWAGE DISPOSAL SYSTEM Image: NOTE: Limitations of visual inspection is in effect.
	Type: Septic system Holding tank Not determined Location:
	Percolation field free of trees/shrubs: Yes No Not determined Location:
	See Additional Comment Page

1/2-Yr. Priority Ke	EXAMPLE 7 WEAK OF CONTRACT OF CONTRACT.
Majo Mino N/A Mon Func	LIMITATIONS:
Major Repair Minor Repair N/A Monitor Functional	We are unable to detect or predict damage to interior finishes as result of slow or intermittent water leaks. Mold
Repa Repa r r	detection/indentification and/or analysis is beyond the scope of a visual inspection. Thermal seal failures of
ur ir	thermalpane glass is beyond our ability to detect or predict.
	WALL & CEILINGS
	Predominant material type: 🗹 Plaster & wood lath 📃 Plaster & gypsum lath 🗹 Drywall 🔲 Wood/paneling
	General condition of surfaces: Solution Fair condition Substantial refurbishing recommended/ paint.
	Most/ some ceilings/ walls are aged; drywalling over existing surfaces is recommended in the near future.
	 Repair required at: Some older cracks on partition wall between the rear bedrooms. doesn't appear to be recent.
	Wall structure type: Wood Steel Masonry & strapping Alternate ceiling type: Suspended/ acoustic tile
	Water stains noted at which were measured dry. Monitoring required.
	FLOOR COVERINGS
	Predominant material type: 🗹 Carpet 🗹 Hardwood 🗌 Wood 💭 Vinyl 🗹 Laminate 🗹 Tile/Stone
	General condition of surfaces: 🗹 No hazardous defects exist(normal wear) 🔲 Substantial refurbishing recommended
	Repair required at: There is a dip in the 2nd level floor. There doesn't apppear to be any active movement.
	2nd/ 3rd level floor system was not originally intended for habitable use and is presently limited in its ability to support a normal load.
	The selttlement on 2nd floor is not uncommon of older homes
	PRIMARY WINDOW OPERATION/CONDITION
	Function of ventilating windows
	Good condition Fair condition Minor adjustment most/ some units
	Major refurbishing/ replacement is recommended:
	Window glazing/panes:
	Thermal windows with highly visible defective seals/ condensed panes at:
	Various cracked glass panes are noted. Most/ some panes are single glass only; improvement recommended
	Window handles/locks/hardware:
	Good condition Fair condition Some localized repair/ upgrading/ missing
	All/most operating windows have insect screens. Few/ most insect screens are required to be repaired/installed
	PRIMARY DOOR OPERATION/CONDITION
	Function of interior doors:
	Cood condition Fair condition Minor refitting to most/ some doors
	Door hardware-general conditions:
	Cood condition Fair condition A few missing handles/ repairs required Most require improvement
	STAIRWAYS/RAILINGS & BALCONIES
	Condition of primary staircase(s): Limited headroom and/ or clearances.
	🗌 Good condition 🛛 Fair condition 📝 Loose treads/ minor repair 🔛 Major repair/ replacement recommened
	Condition of primary railings/guards:
	✓ Good condition
	🔲 Installation of safety handrail recommended/ upper flight only 🛛 Guardrails too low/ spindle spacing unsafe/ missing
	Condition of basement staircase(s): 🗹 Limited headroom/ clearances.
	🗹 Good condition 🛛 Fair condition 🔲 Loose treads/ minor repair 🔲 Major repair/ replacement recommened
	Condition of basement railings/guards:
	Cood condition Fair condition Loose rails/ spindles/ minor repair
	🔲 Installation of safety handrail recommended/ upper flight only 🛛 Guardrails too low/ spindle spacing unsafe/ missing
	Condition of 3rd floor/supplementary staircase(s):
	Good condition Fair condition Loose treads/ minor repair Major repair/replacement recommened
	Condition of 3rd floor/supplementary railings/guards:
	Good condition Fair condition Loose rails/ spindles/ minor repair
	Installation of safety handrail recommended/ upper flight only Guardrails too low/ spindle spacing unsafe/ missing
	See Additional Comment Page

	1/2-Yr. Priority Ke	ATTIC/ROOF SPACES
	Majo Mino N/A Mon Funo	LIMITATIONS:
	Major Repair Minor Repair N/A Monitor Functional	The inspection process cannot predict the ability of the roof stucture to support heavy snow loads.
	epai epai	Could not access attic due to seized cover/ no attic access/ further review is required prior to proceeding.
		Attic reviewed at hatch access. Floor not walked on. All attic spaces were not fully inspected.
		ACCESSIBILITY
		Cood/ fair access to attic 🔲 Attic floor walked on 📃 Attic has lofting potential
		Attic roof space has been converted into living space 🔲 Attic interconnected with adjacent dwelling. Install firewall/fire separation.
		No access to attic is installed Access not required Access to roof spaces/ knee wall spaces is recommended.
		🗌 Relocate access 📃 Increase size of attic access 🔲 Insulate/ weatherstrip hatch 🔲 Additional access required.
		VENTILATION
		✓ Domed roof units ✓ Soffit vents Gable/ridge vents Attic fan(s)/ turbine vents Spaced board sheathing
		Roof vent(s): Good condition Fair condition Repair/ replace roof vents at:
		Additional vents recommended at soffit/ ridge area 🔲 Soffit baffles to be installed in the attic at eaves section.
		INSULATION
		Approx. R-value: □ R0 to R15 (0-5) □ R20 to R28 (6-8) ✓ R32 to R40 (10-12) □ R40+
		Type: ✓ Cellulose fibre
		Additional insulation recommended to be installed on the attic floor. 🔲 Additional insulation recommended around air ducts.
		Insulation is unevenly distributed on attic floor. Add/ redistribute insulation. Evidence of vapor retarders: No 💌
		ROOF STRUCTURES (where visible)
		Type: 🗹 Rafters/ Collar ties 🔲 Trusses 🔲 Good condition 🔛 Fair condition 🔲 Some localized repairs/ defects
		Additionalcollar ties/ structural support is recommended.
		ROOF BOARDS/SHEATHING (where visible)
Сор	1	Type: Plywood 🗹 Board sheathing 🗹 Good condition 🗌 Fair condition
Copyright CBCG 2016 -		Probability of replacement of some/ most sheathing with next shingle replacement
1t CE		Fair/ poor condition due to inadequate ventilation. Possible mold/ mildew residue developing on sheathing.
CG		
2016		See Additional Comment Page
		KITCHEN
cens		COUNTER TOP CONDITION Counter top is in: Good condition Fair condition Requires repair/ replacement
ed to		Localized damage around faucets; counter replacement is imminent.
Prac		CABINET(S) CONDITION
Licensed to Pradeep Samaroo until November 15,		Cabinet condition installation & operation is in 🗹 Good condition 🗌 Fair condition
Sam	1	Repairs required to drawers/ door fronts/ shelving/ cabinet mounting.
aroo		STOVE POWER SOURCE
until		Plug receptacle installed/240V 🗹 Direct wire connection/no receptacle 🔲 Gas stove connection 🗌 T.S.S.A tag required 📃 Not visible
Nov		EXTRACTION FAN
/emb		Exhaust fan is in 🔲 Good condition 🔲 Fair condition 🔲 Repair/ replace fan 📄 Installation of exhaust fan recommended
er 15		Re-circulating fan is functional Fan is not vented to exterior
5, 2025		ELECTRICAL RECEPTACLES
25		Good/ fair number of receptacles installed at counter level Ungrounded receptacles(s) in kitchen noted
		Limited number of receptacles in kitchen 🔲 Additional split duplex receptacles recommended
		SINK/FAUCET CONDITION
		Sink is in: 🗹 Good condition 🗌 Fair condition 🔲 Sink requires repair/ replacement
		Faucet assembly is in Good condition Fair condition Requires repair/ replacement/ new washers/ cartridge
		Garborator is in function condition Repair/ replace garborator
		GENERAL CONDITIONS
		The kitchen is in marginal condition. Major remodelling is recommended in the near future.
		See Additional Comment Page

1/2-Yr. Priority K	ey BATHROOMS
Maj Min N/A Mor Funo	LIMITATIONS
Major Rep Minor Rep N/A Monitor Functional	Due to the unpredictable and latent nature of plumbing shower and bathtub enclosure leaks there can be no
Major Repair Minor Repair N/A Monitor Functional	assurances or warranty that leaks will not develop at any time after the inspection date. The development of mold
	is a common result of leaks in the bathroom. We cannot predict or detect damage behind walls.
	SHOWER/BATHTUB ENCLOSURE CONDITION
	The ceramic tile/wall surfaces are in good general condition.
	Sealant and grout touch-ups/ repair required at all/most shower/ bathtub enclosures.
	Shower enclosure exhibits no evidence of leaking but is at the end of expected lifespan at:
	Repair/replace tile or wall surface at:
	Complete tile and wall replacement required at:
	Repair/ install shower door/ curtain assembly at:
	FAUCETS/SHOWER HEAD CONDITION
	Shower faucets/ head assembly are in good/ fair general condition
	✓ Tub faucets are in good/ fair general condition
	Shower faucets/ head assembly requires repair/ replacement at:
	Tub faucet requires repair/ replacement at:
	BATHTUB CONDITION
	Bathtubs are in good/ fair general condition Reglazing/re-lining of bathtub recommended at:
	Bathtubs requires repair/ replacement at:
	Whirlpool bath is functional Whirlpool bath requires repair at:
	Whirlpool bath electrical circuit is required to be protected by an accessible GFCI breaker.
	No access panel/ improper access to mechanical equipment at:
	TOILET CONDITION/BIDET CONDITION
byrig	✓ Toilets are in good/ fair general condition ☐ Toilet requires repair/ replacement at:
Copyright CBCG 2016	Toilet is improperly installed to floor (ie) loose at:
3CG	Bidet in good/ fair general condition Bidet requires repair at:
201	WASH BASINS/FAUCET CONDITION & OPERATION
1	Wash basin are in good/ fair general condition.
icens	Wash basin requires repair/ replacement at:
sed to	Faucets are in good/ fair general condition. Faucet washers/ cartridge are to be replaced.
) Pra	Faucets require repair/ replace at:
deep	ELECTRICAL Receptacles are in functional condition at all/most bathrooms IN None installed.
Sam	· · · · · · · · · · · · · · · · · · ·
laroo	Installation of GFCI receptacle recommended at: Repair/ replace receptacle at: Ungrounded receptacle at:
unti	
	Repair/relocate light fixture at:
vemt	VENTILATION: WINDOWS/EXHAUST FANS Ventilation is provided by a functional window and/or a functional mechanical exhaust fan.
Licensed to Pradeep Samaroo until November 15, 2025	Repair/ replace exhaust fan at:
5, 20	
25	
	Exhaust fan installation recommended at:
	Rework window to provide proper operation/ replace window at
	Window is located in shower enclosure; protection of window is required at:
	SAUNAS/SPAS/STEAMER
	Sauna/ steamer/ hot tub are in good/ fair general condition.
	System/ components require repair/ replacement at:
	GENERAL CONDITIONS
	The bathroom is in marginal condition. Major remodelling is recommended in the near future.

1/2-Yr. Priority Ke	y FIREPLACES
Major Repair Minor Repair N/A Monitor Functional	LIMITATIONS:
Major Rep Minor Rep N/A Monitor Functional	Inspecting condition of flue and ability of fireplace to draw is beyond scope of visual inspection. Camera inspection of flue is rec'd.
lepai lepai	FIREPLACE TYPE
<u> </u>	Masonry fireplace at:
	Wood-burning stove at:
	Factory-built fireplace at:
	Wood/ coal insert at:
	Gas fireplace at: in livingroom - obsolete
	FIREPLACE CONDITION
	Combustion chamber is in good/ fair condition.
	Hearth extension is in good/ fair general condition Smoke chamber is in good/ fair general condition.
	Combustion chamber requires repair at:
	Damper requires repair/ replacement at:
	Hearth floor requires repair/ extending at:
	Smoke chamber requires repair at:
	Note: Basement fireplace may not draw properly. Alternativerepair/ improvement strategy recommended
	Flue cleaning recommended at: Service/ clean/ repair gas fireplace(s)
	Roughed-in fireplace installed at:
	Non-combustible base/lateral clearances from combustible materials of wood burning stoves.
	Good condition Fair condition W.E.T.T inspection/ camera inspection of flue recommended.
	Improvement required at: Stainless steel liner recommend at:
	Do not use fireplace until certified as safe.
	See Additional Comment Page
	LAUNDRY ROOM
	CLOTHES DRYER CONNECTIONS
	Power source:
	Dryer venting: Properly vented to the exterior. Duct/ vent requires repair/ cleaning/ repair at exterior No venting installed
	Replace with metal duct. Vented through window; rework.
	WASHING MACHINE CONNECTIONS
	Power source: Plug receptacle available & properly grounded. No plug receptacle installed/replace receptacle.
	Water connections: 🗹 Satisfactory connections/ shut off valve.
	Connections require repair/ replacement/ relocating. Replace connection hoses with steel braided lines
	LAUNDRY TUB/FAUCETS Installation recommended
	Tub is in: 🗹 Good condition 🔲 Fair condition 🔲 Tub requires repair/ replacement
	Faucet is in: 🗹 Good condition 🔲 Fair condition 🔲 Faucet requires repair/ replacement 📃 New washers required
	EJECTOR PUMP FOR LAUNDRY TUB Good condition Fair condition Pump requires repair/ replacement
	FURTHER INQUIRIES TO SELLER OF PROPERTY
	Ask seller for any manufacturer's warranties or service contracts for appliances and equipment and recent home improvements.
	Ask seller for plans/drawings/project documentation and permits for any improvements to the property.
	Ask seller for list of tradespeople and service technicians who have worked on the property.
	Inquire to seller about cause of water stain on ceiling/ wall.
	▼