20/20 HOME INSPECTIONS

40 Stockell Crescent

Ajax, Ontario L1T 0M4

Telephone: 416-518-9680

HOME INSPECTION REPORT



Property Address: 141 Marlborough Pl Date of inspection: May 23 2024

Prepared By:

Pradeep Samaroo, RHI

20/20HOMEINSPECTIONS

40 Stockell Crescent Ajax, Ontario L1T 0M4 T: 416-518-9680 E: pradeep_samaroo@hotmail.com W: www.2020homeinspections.ca

Our Vision is Your Peace of Mind

Residential and Commercial Property Inspections Buyers Home Inspections Inspections for Sellers Prior to Listing Thermal Imaging Inspections of Newly Constructed Homes

20/20HOMEINSPECTIONS			
40 Stockell Crescent Ajax Ontario L17	Г 0М4		
Telephone: 416-518-9680 w	www.2020homeinspections.ca	pradeep_samaroo@hotmail.com	
PRE-PURCHASE SUMMARY			
Address: 141 Marlborough Pl	Municipality: Toronto	▼ Inspection Date: May 23 2025	
General Information: Good "bones" but in need of	`updating	Inspector: Pradeep Samaroo, RHI	
Age of House approx 125 years. Constru	iction Type: 2 storey 💌 row house	brick veneer	
This house is in partially updated v function	onal condition in comparison to other sin	nilar age and size homes in the neighbourhood.	
On average; a house of similar age/size and quality	will cost you \$3500-\$4500 💌 for ann	ual general repairs and on-going maintenance.	
You will require \$5,000	(minimum) to address the functi	onal concerns listed in the the report over the next $0-1$ years.	
MAJOR SYSTEMS - GENERAL DESCRIPTIO	ON AND CONDITIONS:		
Roofing systems: asphalt shingles 💌 Second	lary roofing system: flat roof membrane		
Exterior wall systems: brick veneer	Secondary wall siding:	▼ cedar shingles ▼	
Windows(general): Mostly updated: vinyl sliders/c	casements 💌		
Electrical Systems			
Main service size 100 - amp knife switch/carts	ridge fuses 🔻 Predominant branch wir	ing: romex/copper	
Heating System			
Fuel type: natural gas 💌 Age of central heating a	appliance: 4 years Sy	stem type: high-efficiency forced air furnace	
Cooling System			
System type: central A/C-low velocity	Age of cooling equipment: 4	years Approx. tons: 2 tons	
Plumbing System			
Main supply: 1/2 inch copper line	Predominant water lines	T	
Interior (general): good overall functional conditio	n 💌		
HOMEOWNER INSURANCE CONCERNS			
None Identified Older glass plug fuse panels	V		
	v		
REQUIRED REPAIRS/MAJOR SYSTEMS AN			
Upgrade electrical panel		frame $0-1$ years Budget \$ 1500	
Miscellaneous interior repairs		frame 0.1 vers Budget \$ 1000	
	▼ Time		
Install CO and Smoke detectors			
Install guardrails for basement staircase		frame 0-1 vears Budget \$ 500	
	Time		
	Time	frame years Budget \$	
	Time	frame years Budget \$	
	Time	frame years Budget \$	
OTHER RECOMMENDATIONS			
		▼	
		T	
		v	
ADDITIONAL INFORMATION REQUIRED			
		V	
		·	
		· ·	

IMPORTANT NOTE:

This report should not be considered as a complete home and property inspection. Please review the entire report prior to proceeding with the next step of the transaction.

20/20HOMEINSPECTIONS	0					
-	Ontario L1		NO1 • ·			
Felephone: 416-518-9680	NORCH		Ohomeinspections.ca	pradeep_sa	amaroo@hotmail.com	
PRELIMINARY BUILDING		ON REPOR	KI		Maniainalita Tanat	
Property Inspected 141 Marlb	orough PI		T '		Municipality Toronto	-
Inspection Date May 23 2025			Time 12:00		Inspector Pradeep Samaroo, RHI	-
SUMMARY (GENERAL CO						
-		-	-		ling/dwelling is; mostly original.	
Recommended improvements of			•	ed in the report.		
It is suggested that the highligh			-	•		
Please de advised that failure		-	omptly may result in addi	-	s and/or consequential damages.	
	MINOR	MAJOR		MINOR	MAJOR	
	REPAIRS	REPAIRS		REPAIRS	REPAIRS	
Roofing			Structure		K	
Exteriors	*		Electrical			
Interiors			Heat/Cool			
Maintenance	•		Plumbing			
Comments: Though dated, this	House is in	good operat	ting condition			
					care. This consulting service is limited to the phy	
 The preliminary inspection The inspector/inspection fit The client is advised to and The client is warned that report are not carried out in 	n is partially irm will not a nually budge esultant dam n a timely m	designed to assume any o et at least 1% ages may oc anner. This i	reduce your risk of buying a of your risk in buying an old 6 of the building's value for ecur to the building systems is especially the case in matt	an older home. Her property. Fur general mainten or components is ters concerning	-	
7) Cost estimates if provided	in this repor	t are minimu	ums and are intended to be a	rough guidelin	e only. Estimates are based on the	
most cost effective solution	n to address	the problem	and will not include bettern	nent. Obtain acc	surate cost estimates from contractors immediatel	у.
8) The preliminary inspection	n does not co	over code con	mpliance issues set by gover	mments or other	r regulatory authorities.	
9) The preliminary inspection	n does not tal	ke into accou	unt manufacturer's recalls an	nd eligibility for	r mortgage insurance, building or homeowners in	suran
10) The preliminary inspection	n process is c	conducted in	a fair and impartial manner	. Accordingly th	nis report is not provided as an aid for negotiation	1
in a real estate transaction.	We do not o	overstate or u	under value any issue to ben	efit any party.		
11) The purchaser is advised to	o ask the pro	perty owner	if they are aware of any def	ects that would	not normally be detected by a visual inspection.	
	-				ons remain unchanged or retain the inspector for t	this ta
-	-					1115 tu
				-	iately to arrange a site visit at no	
-				-	inflicting opinion and prior to any corrective work	
	-		-	-	. I accept this report and supplements accordin	-
				-	nal time and is not a guarantee of present or fi	
		-		-	or to re-evaluate the property prior to closing	101
evidence of new water leaks a Name of Client Stuart Sankey	nu/or items	not previou			(Res.)	
			(Bus.	· I	(KCS.)	
Current Address			Oth	er		1

Copyright CBCG 2016 - Licensed to Pradeep Samaroo until November 15, 2025

GENERAL CONDITIONS/SPECIAL SITUATIONS & LIMITATIONS

GENERAL CONDITIONS/S	I ECIAL SITUATIONS & LIMITATIONS
The primary purpose of the insp	pection and report is to educate the prospective purchaser/owner about the general condition of the building.
Repair and cost effective impro	ovement advice is provided to increase this understanding. It is not a contractual obligation nor is it possible for the
inspector to identify all potentia	al problems solely on the basis of a visual examination. 80% of first year repairs should be revealed: not 100%.
DEFINITION OF TERMS U	SED IN THE PRELIMINARY INSPECTION REPORT:
Functional	(1) system was performing its' intended purpose at the time of the inspection, no significant loss of functionality
Monitor and/or Maintenance	(1) item is marginal; will require future repair or replacement. Owner is advised to monitor.
	(2) preventative maintenance repairs are required by property owner.
Minor Repair	(1) minor repair is recommended; cost should not exceed \$3000.00 and/or repair is not urgent.
Major Repair	(1) major repair is recommended; cost will exceed \$3000.00. Obtain contractor's estimates immediately.
Good Condition	(1) no defects were discovered that should require repair within the first six months, no significant loss of functionality
	Note: Limitations of a visual inspection and visually accessible physical evidence are in effect.
Fair Condition	(1) system or component is performing its intended purpose; but due to its age can fail at any time.
N/A	(1) not applicable/not accessible/not inspected/not installed or does not pertain to the subject property.
(?)	(1) performance/future performance of system or component is unpredictable. Further review is required.
	g the summary portion of the inspection is to discuss the significant aspects of their findings. There is no time limit
on these discussions. Ask as ma	any questions as you like to ensure we have addressed your concerns. The inspection process is a two-part system:
the verbal survey and the repor	t. This report is not transferable to third parties as it will not clearly convey the information herein.
WEATHER CONDITIONS	
Snow/ rain/	limited the extent of the exterior inspection. Roof/ grade/ walkway/ decks were snow covered.
Absence of recent heavy rat	infall limited scope of basement foundation inspection.
The outdoor temperature w	as too low to safely test the air conditioning system(s)/distribution systems and summer comfort.
The outdoor temperature w	as too high to sufficiently test the central heating system/distribution systems and winter comfort.
Weather conditions during in	ispection: 🗹 Rainy 🗌 Snow 🔲 Clear 🗌 Cloudy 🗌 Windy Temperature 10C to 15C 💌
INACCESSIBILITY	
Basement/ Garage storage	limited access/ visibility. 🔲 Excessive storage limited access to:
Areas/ systems/ work in pre-	ogress not fully visually inspected:
Other specific limitations:	
Plumbing system winterize	d (not fully inspected) Inspection of plumbing limited due to recent non-usage.
Building substantially furni	shed 🔲 Building occupied 🗹 Buildingvacant/ partially 🗹 Building unoccupied
RENOVATIONS/REMODE	
	ned in this report are based on the intent of the client that upgrades will be done to the following:
Exterior Addition	
GENERAL/ORIENTATION	
For reference purposes the	
Seller has warranted the fol	lowing:
Further inquiries to seller is	recommended regarding:
TYPE OF INSPECTION/TR	
	Pre-sale inspection Newly built house inspection Post-purchase inspection
Home owners inspection	Estate sale Power of sale Private sale Pre-lease/rental inspection Pre-offer inspection
ATTENDANCE	
Buyer/client not present at i	inspection Client partially attended inspection Client fully attended inspection
Also in attendance: Seller	
EXCLUSIONS	
	ools & related equipment is beyond the scope of our visual inspections.
	are the responsibility of the the condominium corporations. Review particulars with legal counsel.
	systems/trees/heat exchangers/flue interiors/outbuildings/security system/intercom/spas/wood destroying insects/vermin
	systems/reces/rear exchangers/rue interiors/outourings/security system/intercom/spas/wood desitoying insects/veninin

and animals/underground storage tanks/sub-grade plumbing drains/environmental testing/UFFI/mold and other indoor air quality contaminants/ window air conditioners/asbestos containing material/septic tanks/wells/marine structures and other items not specifically mentioned in the report are not included within the scope of this inspection. We do not disassemble equipment/bore holes into walls/floors and ceilings/move furniture and boxes/lift up carpets.

COST ALLOWANCES/TIME FRAMES AND SHORT TERM COURSE OF ACTION YOUR EXPECTATION LEVEL

We have included this summary to help you prepare and budget for future work. Please be cautioned that the following noted items represent the minimum amount of work that you will address in the future. Be aware that you may receive opinions from other tradespeople or knowledgeable parties that can vary drastically from our own. In this instance we require you to contact us immediately to seek clarification or request a site inspection at no further expense.

GENERAL CONDITION AT THE TIME OF THE PRELIMINARY INSPECTION

The subject property requires less current repair consideration than the average house/building of similar vintage

The subject property requires an average amount of repair consideration compared with other houses/buildings of similar vintage.

In the subject property requires more current repair consideration than the average house/building of similar vintage.

The average annual repair/maintenance budget for a home/building of similar size and vintage is: \$4500-\$5500					
\checkmark over the first 0 -		st 0 - 5 Years 🔲 over the co	urse of		
To address the functional concerns listed below you must budget at the very least the following amount: ✓ \$2000-\$5000 \$5000-\$10000 \$10000 \$15000 \$15000 \$15000 \$					
AREAS REQUIRI	NG CONSIDERATION				
Roofing Systems:	Roof Coverings	Eavestroughs/down pipes	Overhangs	Chimneys/flashings	Skylights
Exterior:	Brick/sidings/walls	Windows/doors	Site drainage	Porches/decks	Painting
	Garage/sheds	Driveway/walkway	Landscaping	Fencing/gates	
Structures:	Crawlspaces	Beams/columns	E Floors	Even Foundation wall	
Electrical Systems:	Main service/panels	Lighting fixtures/switches	Branch wiring	Receptacles/outlets	
Heat/Cool Systems:	Furnace/boiler	Distribution: ducts/rads	AC system	Filters/humidifiers	
Plumbing Systems	Main water service	Distribution piping	Drains/vents	Fixtures/fittings	
Interiors:	Kitchen	Basement spaces	Bathrooms	Attic/roof spaces	Fireplaces
4 9 7	Walls/ceilings	Floor coverings	✓ Stairs/railings	Appliances	Decorating
Ganaral annual 4	& soosonal axtorior/interic	r building maintananga & smal	1 ronging		

🗹 General annual & seasonal exterior/interior building maintenance & small repairs

YOUR RECOMMENDED COURSE OF IMMEDIATE ACTION:

Please review the preliminary report in its entirety and ask for clarification on any matter. This page must not be relied upon in isolation. Prior to continuing with the next step of the transaction/project consider the issues listed in the report. We advise you to consult with your realtor or lawyer regarding options on how to proceed. Also instruct your lawyer to obtain Title Insurance for you. You should request additional inspections as outlined in the full report to address your special concerns and/or matters that we can not inspect. You must also factor the limitations of the building inspection in your decision making process. 80% of first year repairs should be revealed: NOT 100%. Therefore you must anticipate and budget for the 20% unforeseen deficiencies that will not be discovered by a visual inspection. You must ask the seller for invoices/applicable warranties/plans and/or permits for work completed in the last five years.

This house is in good functional condition with no major deficiencies. It is however in need of updating/upgrading.
It is however in need of updating/upgrading.
Further clarification regarding:
is required of the:
is required of the:
Further inspection/evaluation is required regarding:

☑ OBTAIN CONTRACTORS QUOTES/REPAIR SPECIFICATIONS ON ANY MAJOR REPAIR NOTED HEREIN IMMEDIATELY.

1/2-Yr. Priority Key	ROOF STRUCTURES COVERINGS & RELATED SYSTEMS
Maj Min N/A Mor	METHOD OF ROOF INSPECTION
Major Repair Minor Repair N/A Monitor Functional	Fully accessed (walked on) At eaves At ground with binoculars (too steep/inaccessible) Note: (limitations in effect)
epaii epaii	LIMITATIONS
	 Majority of the above elements were snow/ ice/ frost covered. Flat roof is covered with gravel/ decking Due to the unpredictable and latent nature of roof leaks no assurances or warranty can be provided that your roof will not
	leak within the approximated expected lifespan stated in this report. Ice damming problems are beyond our ability to predict. ROOF COVERINGS TYPE
	Asphalt shingles are the principal roof covering of the building.
	Asphalt shingles cover all sloping roof surfaces of the building.
	covers the principal flat roof surfaces of the building.
	is the principal roof covering of the building.
	covers the roof surface at the
	✓ Used drone to inspect the roof
	ROOF COVERINGS CONDITION (where visible)
	Estimated remaining lifespan of roof shingles/coverings: 🔲 NOTE: Estimated lifespan based on visible portion of roof only.
	Shingles $=$ 15 years $?$
	Flat $=$ 10 years $?$
	General condition of flat roof coverings: ☑ Good
	Current repair is required at:
	Roof covering replacement is required at:
	□ High probability of replacement of roof coverings within years. □ Repairs/ roofing tune-up is required soon/ before next application of roof coverings ✓ Annual visual inspection required.
	✓ Trim tree branches/ vines away from roof edge.
	ROOF/WALL FLASHINGS & JOINTS (where visible)
	All/most flashings are in Good condition Fair condition
	Repair/ replace/ install flashings at:
	Repair/ replace all flashings with next roof covering replacement. Caulking rec'd at:
	ROOF DRAINAGE
	Type: Aluminum Galvanized steel Plastic Copper Lead Hoppers/Scuppers
	Roof drainage is in: Good condition Fair condition Seasonal cleaning required
	Gutters Downpipes/ drains require repair/ extending/ painting at:
	Extend downpipe from upper level roof directly into lower gutter/ eavestrough. 🗹 Repair loose gutters; nails.
	Extend/ relocate downpipe(s) at south east discharge pipe is broken corner/ side 4'-6' away from building Add drainage pads
	Replacement/ Installation of gutters/ downpipes recommended at:
	☐ Gutters & downpipes are approaching end of functional life.
	SOFFIT AND FASCIA
	Type: Aluminum Plywood Vinyl Vinyl
	Soffit & fascia are in: Good condition Fair condition Painting of soffit/ fascia required
	Repairs are required/ recommended at: Peaked roof at front
	Replacement/ new aluminum cladding of soffit/ fascia is recommended in future. SKYLIGHTS ROOF WINDOWS & SOLARIUMS
	Type: Factory built Home-made (usually of sub-standard quality)
	Units are in: Good condition Fair condition Evidence of leakage at:
	Annual maintenance/ caulking recommended.

See Additional Comment Page



Loose fascia and gutters



Seasonal cleaning of gutters and debris on flat roof is recommended

1/2-Yr. Priority Ke	y EXTERIOR (GENERAL CONDITIONS)
Major Re Minor Re N/A Monitor Function	Approximate age of building is 125 years. Building has been substantially renovated ? years ago. N/A
Major Repair Minor Repair N/A Monitor Functional	TYPE OF STRUCTURE CONSTRUCTION TYPE OCCUPANCY TYPE
pair pair	□ Detached
	Semi-detached Brick veneer Basement apt. added Triplex
	Row house/fully attached Solid masonry Multi-purpose occupancy Fourplex
	Condominium/townhouse Wood frame-upper level
	✓ end unit
	EXTERIOR WALLS/WALL COVERINGS
	Brick/Masonry (inspected at grade level)
	✓ Masonry units & mortar are in: ✓ Good condition □ Fair general condition.
	Mortar repair; tuck point recommended at:
	Brick repair required at:
	Non-structural cracks noted which could/ should be repaired. Repair sills at:
	Wall sidings (inspected at grade level)
	Type: Aluminum Vinyl Wood Insulbrick 🗹 cedar shingles
	Good condition Fair general condition. Repair required/ recommended at:
	New wall coverings/ re-cladding recommended at:
	 Application of protective coatings (paint/ stain) recommended to most/ all wood/ other surfaces. Caulking/minor repairs at trimwork:
	Foundation Wall (above grade)
	Foundation wall is in: Good condition 🖉 Fair condition 🗌 Non-structural cracks noted
	Requires tuck pointing at:
	Requires parging/ repair at:
	Chimneys
	Type: Masonry Metal Side wall venting None required
	Good condition Fair condition Requires repair/ tuck pointing Flue cap recommended
	Requires new chimney cap/ drip edge Requires rebuilding/extending Remove obsolete chimney
	Exterior Doors
	Exterior doors at: Front Side Rear are in: Good condition Fair condition
	Repair/ replace:
	Install storm/ screen door at:
	Upgrade/ caulking/ painting Upgrade weather stripping Upgrade locks at:
	Windows (General)
	Material Type: Aluminum Wood Vinyl trim Wood/ aluminum storm
	Predominant styles: Single/Double-hung 🗹 Casement 🔽 Sashless 🗌 Horizontal sliding 🔲
	Windows are in: 🗹 Good condition 🗌 Fair condition 🔲 Upgrade caulking/ painting
	Storm/ screen systems are recommended to be upgraded at:
	Repair/replace window frame/ sills at
	Vindow refurbishing/ replacement recommended: rear windows
	GRADING/SITE DRAINAGE/RETAINING WALLS ☐ Good condition Fair grading conditions exist alongside the foundation(s) of the building.
	Grading conditions require improvement at: 🔲 Front 🗌 Rear 🔲 Side 🔲 Patio/ walkway slopes toward wall
	Retaining walls are in: Good condition Fair condition
	Retaining walls require repair/ replacement at:
	Window wells are in: Good condition Fair condition
	Window well repair/ install at:
	See Additional Comment Page

1/2-Yr. Priority Ke	y EXTERIOR (GENERAL CONDITION) continued
Maj Min N/A Mor	GARAGE/OUTBUILDING/CARPORT
Major Rep Minor Rep N/A Monitor Functional	Attached Garage Good condition Fair condition Poor condition
Major Repair Minor Repair N/A Monitor Functional	Gas proofing measures of common walls with house required; provide gas seal. Repair holes in walls/ cellings.
, , ,	🗌 Entry door into dwelling requires self-closing device /repair self-closure. 🔲 Weather stripping/ caulking required to door/ frame.
	Detached Garage Good condition Fair condition Poor condition/ Remove
	Structure type: Wood Frame Solid Masonry Brick Veneer Repairs to walls required
	Roof Coverings
	Good condition Fair condition Replace roof coverings soon Eavestroughs recommended/ repair/ install
	Caution: Underground/ overhead wires supplying power to garage/ shed. Electrical power to garage is recommended
	Overhead Door Operation Good condition Fair condition Requires repair/ replacement/ painting
	Automatic Door Operation Install dedicated receptacle for garage door opener; avoid extension cord use.
	Good condition Fair condition Requires repair/ replacement Adjust/ no auto-reverse
	WALKWAYS/DRIVEWAYS ☐ Good condition
	Repair work required/ recommended at:
	PORCHES/DECKS/BALCONIES (egress to exterior)
	Location: Rear Type: Wood masonry concrete steel unable to access under deck
	Structural supports: Good condition Fair condition I fair condition
	Decking: Good condition Fair condition Image to control
	Steps/stairs: □ Good condition □ Fair condition □
	Guards/handrails: Good condition
	Location: Type: wood masonry concrete steel unable to access under deck
	Structural supports: Good condition Fair condition
	Decking: Good condition Fair condition
	Steps/stairs: Good condition Fair condition
	Guards/handrails: Good condition Fair condition Guardrails low/ spacing unsafe/ repair/ missing Handrail/guardrail recommended alongside steps at: Image: Condition in the steps at: Conditin the steps at: Condition in the steps at: C
	EXTERIOR PLUMBING CONDITIONS Winterized/ could not test. Garden hose connection location: Front Rear Side Garage None
	✓ Good condition Fair condition Repair/ replace at:
	Main vent stack(s)
	✓ Good condition
	Good clearance from windows/ doors No evidence of vent stack for plumbing system visible.
	EXTERIOR ELECTRICAL CONDITIONS
	Exterior plug receptacle location: Front Rear Side Garage
	Good condition Fair condition Requires weatherproof cover Receptacle not grounded
	Requires repair/ replacement at:
	✓ All/most exterior receptacles are required to be replaced with GFCI type.
	Lighting location: Main entrance Side entrance Rear entrance Garage
	Fixture(s) are in: Good condition Fair condition
	Repair/replace at: Installation recommended at:
	Service entrance: (electrical cables feeding house from street transformer)
	✓ Overhead entrance Underground/lateral entrance
	Mast head conduits/ meter base properly affixed to building. Repairs are required at



Some sills on rear windows show signs of rot



Discharge pipe connected to the downspout is disconnected. Water is discharging against foundation.

1/2-Yr. Priority K	FOUNDATIONS BASEMENTS & STRUCTURES
Majo Mino N/A Mon Funo	LIMITATIONS:
Major Repair Minor Repair N/A Monitor Functional	Substantially/partially finished basement/ crawlspace limited observations.
kepa: kepa r nal	Z Due to the unpredictable and latent nature of basement leaks no assurances or warranty can be provided that your basement will not leak
<u> </u>	in the future. We caution you that it is common for basement leaks to develop at any time in the future where no such leaks existed in the pa
	We cannot detect previous leaking or predict future leaking.
	We are unable to detect existence or type of mold at interior space. Further investigation is recommened.
	FOUNDATION CONSTRUCTION TYPE
	🗹 Continuous foundation 🛛 Masonry/ wood piers 🔲 Slab on grade 🔲 Wood beam on grade
	ACCESS/BASEMENT TYPE
	🗹 Full basement 🔲 Crawlspace 🔲 Basement & crawlspace combination 🔲 Crawlspace fully/ partially accessed
	Crawlspace is interconnected with adjacent dwelling
	FOUNDATION MATERIAL TYPE
	Brick 🗹 Stone Concrete block Poured concrete Preserved wood foundation
	Foundation wall interiors not accessible for visual inspection.
	Non-structural cracks were observed which could be a source of future water penetration.
	- · · ·
	EXTENSION/ADDITION at the supported with a different foundation type than the main building.
	Continuous concrete Masonry/ wood piers Slab on grade Wood beam on grade
	Crawlspace Full basement No visible accessibility Access to crawlspace is recommended.
	Repairs/ improvements are required at:
	INTERIOR COLUMNS & BEAMS/INTERIOR LOAD SUPPORTS (BASEMENT LEVEL)
	Columns & Walls: Wood Steel Masonry Not visible
Co	Beams: Wood Steel Paralam/Engineered wood Not visible
ovnie	Support system members are in: Good condition where visible Fair condition where visible
tht C	Repairs to support load are required at:
Copyright CBCG 2016 -	FLOOR (BASEMENT)
201	Concrete Finished (covered; limited observations) Good condition Fair condition
	Unfinished/exposed soil 🔲 Raised wood(limited observations) 🔲 Removal of raised wood sub-floor is recommended.
Licet	
	FLOOR JOISTS/FLOOR SYSTEM
censed to Pradeep Samaroo until November 15.	Type (floor & ceiling joists where visible)
radec	✓ Wood joists
en S.	Floor system appears to be in: 🗹 Good condition where visible 🔲 Fair condition where visible
amai	Some localized repairs/ defects Repair/ replace floor joists at:
	BASEMENT WINDOWS/VENTILATION & INSULATION
ntil	Good ventilation 🗹 Fair natural ventilation supplied to basement/ crawlspace.
Nov	Replacement/ upgrade of all/ some basement windows are recommended.
emb	Supply ventilation to: Weather strip cold storage room door.
er 15	Insulation recommended at:
	WATER SEEPAGE/PENETRATION (visible condition only with use of moisture meter)
	NOTE: A mold/IAQ inspection is recommended in the event of active water leaks/dampness or high humidity levels.
	No visual evidence of active water penetration through foundation walls
	Dampness/ efflorescence noted on foundation walls.
	Active leaking/seeping observed through foundation walls at: Behind furnace
	Leak is probably caused by the disconnected downspout discharge on the outside
	Possible major damage to interior finishes as result of ongoing/ previous leaks and moisture. Further review recommended.
	Previous leaking/ seeping which measured dry observed through foundation walls at:
	All areas of foundation walls not thoroughly inspected due to finished wall coverings and storage of material/etc.
	See Additional Comment Page



Active leak. Corresponds to location of disconnected downspout on the exterior

1/2-Yr. Priority Ke	ELECTRICAL SYSTEM
Maja Mine N/A Mon	LIMITATIONS:
Major Repair Minor Repair N/A Monitor Functional	Ratio/ percentage of different wiring types are minimums (if provided). Further review by a licensed electrician is required.
Repa Repa or	We cannot detect existence of knob & tube wiring behind walls and within junction boxes/outlet boxes.
ur ur	Access to main panel is restricted. Could not visually access or open main panel.
	Auxiliary systems not inspected: back-up generators, solar & battery power, low-voltage lighting, pool and spa systems.
	MAIN ELECTRICAL STATION
	Main disconnect rating: 60A ✓ 100A 125A 200A 400A A
	Main panel service rating: 60A ✓ 100A 125A 200A 400A ▲ Main power disconnect type: □ Circuit breaker ✓ Knife switch/cartridge fuse
	Supply voltage: □ 120V/240V □ 347V/600V Service entrance conductors: ✓ Cu □ Al □ Not visible
	Grounding conductor: 🗹 Good condition 🔲 Not Determined 🔲 Requires repair/replacement
	Location of main and distribution panels: 🖉 Basement 🔄 Garage 🔄 Attic 🔄 Shed 📃
	Location of auxiliary distribution panels: 🔲 Basement 🗹 Garage 🛄 Attic 🛄 Shed 📃
	Condition of main/auxiliary panels: Good condition Fair condition
	Good sized main distribution panel is installed. 🗹 Labelling of branch circuit panels is recommended.
	▼ number of circuits are available to properly distribute intended load.
	distribution panel(s) are recommended(for future use).
	Spare circuits available at distribution panel: No V No spare circuits are available. Auxiliary panel is recommended.
	Double tapping noted at some circuits Possible overloaded circuit situation. Monitor.
	DISTRIBUTION Note: Determining branch wiring types is limited to visual inspection only.
	Predominant visible branch wiring type:
	■ Knob & tube (old copper) %
	BX (metallic sheathed) % ? Aluminum % ? Ungrounded older romex % ?
	■ Note: Aluminum wiring is the original/principal branch wire type. 🔽 No unsafe conditions identified with outlets tested.
	BRANCH CIRCUITS OVERCURRENT PROTECTION:
	At main distribution panel(s): 🗹 Glass fuses 🗌 Cartridge fuses 🔲 Breakers
	At auxiliary panel(s): Glass fuses Cartridge fuses Breakers
	Fuses/breakers
	Properly sized fuses/ breakers are presently used to protect branch circuits.
	Arc fault circuit interrupters (A.F.C.I) are recommended to be installed at panel to protect bedrooms/convenience receptacles.
	General
	Fair lighting source is provided to all habitable areas & service rooms.
	Additional lighting recommended at:
	Fair v number of receptacles is provided to all habitable areas & service rooms.
	Additional receptacles recommended at:
	REPAIR/UPGRADING RECOMMENDATIONS
	Upgrade amperage of main service to: 100 AMPS 200 AMPS presently or upon the next home improvement undertaken.
	Most/ some convenience receptacles in dwelling do not have secondary ground (i.e. 2 prong); add GFCI receptacles.
	Rework poor wiring connections at: Basement Garage Attic Panel
	Repair/ replace lighting fixtures/ switches/ ceiling fans at:
	✓ Upgrade to a breaker panel
	Repair/ replace receptacles at
	Missing coverplates/ loose outlets/ exposed cabling observed at:
	 Installation/maintenance of smoke/CO alarms at all floor levels of the building/dwelling is required. G.F.C.I. receptacles are req'd at: kitchen counter exterior garage/ outbuilding bathrooms spa/ whirlpool bath
	garage/ outbuilding baunoonis spa/ winipool baun

See Additional Comment Page

1/2-Yr. Priority Ke	CENTRAL HEATING SYSTEM-FURNACE/FORCED AIR SYSTEMS			
Major Repair Minor Repair N/A Monitor Functional	LIMITATIONS			
	✓ Determining winter comfort with specific areas is beyond the scope of a visual inspection.			
epai epai	✓ The heat exchanger is concealed within the furnace and cannot be reviewed.			
	The outdoor temperature was too high to sufficiently review the heating system/ductwork and winter comfort.			
	GENERAL COMMENTS			
	Energy source: Oil 🗹 Gas Electric B.T.U rating 66000			
	Furnace type: 🔲 conventional warm air furnace 🔲 mid-efficiency warm air furnace 📝 high-efficiency warm air furnace			
	HWT/Combo system Commercial roof top unit Ground source heat pump Fan/coil unit			
	Approximate age of furnace 1 = 4 years. Approximate age of furnace 2 = years.			
	Probability of furnace 1 replacement within the next years high Medium I Low ?			
	Probability of furnace 2 replacement within the next years high Medium Low ?			
	Chimney flue interior: Clay lined Metal lined Brick lined I Direct vent Metal lining of flue required.			
	Furnace room ventilation: 🗹 Good 🔲 Fair			
	Thermostat condition: 🗹 Good 🔲 Requires replacement Thermostat location: 🗹 Good 🔲 Requires relocation			
	Heat source supplied to habitable areas/zones			
	Basement:			
	Habitable room(s) not provided with a heat source:			
	WARM AIR SYSTEM-FURNACE Good overall condition Fair overall condition CO emission test required.			
	Drive/motor operation: 🖉 Good 🗌 Fair 🔲 Requires repair/ replacement			
	Clean air/filtration system: Good Fair Requires repair/ replacement/ upgrade			
	Central humidifier operation: 🗹 Good 🔲 Fair 🔲 Requires repair/ replacement/ removal/ upgrade			
	Burner(s)/coil condition: 🖉 Good 🗌 Fair 🔲 Requires repair/ replacement			
	Limit and operating controls 🖉 Good 🔲 Fair 🔲 Requires repair/ replacement			
	Venting condition: 🗹 Good 🔲 Fair 🔲 Requires repair/ replacement			
	Annual servicing and cleaning recommended. Heating company insurance plan recommended. Air duct cleaning is recommended.			
	Carbon monoxide (CO) detector is required.(all levels) TSSA inspection tag missing. Further review required.			
	DISTRIBUTION SYSTEM - AIR DUCT SYSTEM			
	Condition of supply plenum: 🗹 Good 🔲 Fair 🔲 Requires repair			
	Condition of return plenum: 🗹 Good 🔲 Fair 🔲 Requires repair			
	Condition of branch ducts: 🖉 Good 🔲 Fair 🔲 Requires repair			
	Condition of register/grilles: 🗹 Good 🗌 Fair 🔲 Requires repair			
	Condition of return ducts/inlets: 🗹 Good 🔲 Fair 🔲 Requires repair			
	Air flow at supply outlets: Good Fair Requires repair			
	HEATING FUEL STORAGE DISTRIBUTION SYSTEMS			
	✓ Location of gas shut off/ gas meter/oil tank valve: east side of house			
	Cood condition Paint exterior gas piping Requires repair/ replacement			
	SUPPLEMENTARY HEATING (Cannot substantiate effectiveness of in-floor heating due to the limitations of a visual inspection)			
	Electric heaters/ space heaters/ in-floor heat have been installed at the following areas:			
	Supplementary heating is recommended at the following areas:			
	Rooms above unheated space: garages: crawlspaces:			
	NOTE: These rooms may be slightly cooler than other areas of the house during cold winter days.			

Copyright CBCG 2016 - Licensed to Pradeep Samaroo until November 15, 2025

1/2-Yr. Priority Ke	Y CENTRAL AIR CONDITIONING SYSTEM			
Maj Min N/A Mor	LIMITATIONS			
Major Rep Minor Rep N/A Monitor Functional	Z Due to the unpredictable nature of air conditioner failures no opinion can be given to system life expectancy or future performance.			
Major Repair Minor Repair N/A Monitor Functional	Data plate was missing/ not legible; limited inspection. University Winterized/covered could not review.			
	Solariums/ skylight vaults/ lofts/3rd floor levels are difficult to cool. Supplementary cooling may be required.			
	I The outdoor temperature was too low to safely activate the air conditioning system. Review prior to transaction closing			
	GENERAL INFORMATION			
	Energy source: 🗹 Electric 🔲 Gas 🗌 Combination system			
	System type: 🗹 Split system 🗌 Integral system 📄 Heat pump 📄 Condominium supply/fan coil unit			
	Type: 🗹 Air to Air 🗌 Ground source 🔲 Ductless system 🔲 Roof mounted 🔛 Interior water cooled			
	Approximate estimated cooling capacity of system #1 B.T.U.'s or 2 v tons ?			
	Approximate age of cooling system #1 4			
	Approximate estimated cooling capacity of system #2 B.T.U.'s or tons ?			
	Approximate age of cooling system #2			
	EXTERIOR EQUIPMENT (FOR SPLIT SYSTEMS ONLY)			
	Clear of shrubs or plant growth: 🗹 Yes 🗌 No Unit properly mounted(level) on solid base. 🗌 Yes 🗌 No			
	Unit properly positioned out of direct sunlight: Ves No			
	Electrical connections satisfactory: 🗹 Yes 📃 No			
	Condition of condenser fins: Good Fair Cleaning required			
	Condition of insulation of low-pressure refrigerant line (where visibly accessible): 🗹 Good 🔲 Fair 🔲 Repair required			
	INTERIOR EQUIPMENT			
	Condition (operation) of condensate line: 🗹 Good 🔲 Fair			
	Condition of refrigerant lines: Cood Fair			
	Thermostat condition: 🗹 Good condition 🔲 Requires replacement			
	Thermostat location: 🗹 Good location 🗌 Requires relocation			
	INDEPENDENT SYSTEMS/ATTIC MOUNTED UNITS			
	Equipment in well ventilated area: Yes No			
	Condition/operation of blower coil: Good Fair			
	Proper condensate drain connection: Yes No			
	Air duct connections at main unit: Good Fair			
	Air filter condition: Good Fair Cleaning/replacement required COOLING DISTRIBUTION SYSTEM			
	✓ Using existing heat ducts (see heat distribution system). Using separate air duct system			
	Condition of air duct system:			
	Cooling source supplied to habitable areas/room of:			
	Basement ✓ Yes No Main floor ✓ Yes No 2nd floor ✓ Yes No 3rd floor ✓ Yes No			
	Rooms with no cooling outlet:			
	Functional return-air system on each habitable floor level:			
	Basement ☐ Yes ✔ No Main floor ✔ Yes ☐ No 2nd floor ✔ Yes ☐ No 3rd floor ☐ Yes ☐ No			
	Return-air system is recommended at 2nd/ 3rd level to optimize air flow.			
	GENERAL CONDITIONS			
	System was operating normally at the time of inspection. Check operation of AC prior to transaction closing.			
	System is functioning abnormally; further analysis is required.			
	Manufacturers' warranties appear to have expired on major components; system is in fair overall condition.			
	System/major components are approaching end of expected functional life. Budget for replacement.			
	See Additional Comment Page			


1/2-Yr. Priority Ke	INTERIOR PLUMBING SYSTEM
Maj Min N/A Mon	LIMITATIONS
Major Rep Minor Rep N/A Monitor Functional	Visual access to main drain and drains underneath basement floors is restricted. No assurances can be provided regarding proper
Major Repair Minor Repair N/A Monitor Functional	drainage conditions or performance. Sewer back-up is beyond our ability to detect or predict. 🛛 🗌 Camera inspection recommended.
- -	We are unable to detect/ predict slow leaks in drains and water lines.
	WATER SUPPLY: Municipal Private SEWAGE DISPOSAL: Municipal Private ?
	MAIN SHUT-OFF VALVE/LEVER
	Location: 🗹 Basement utility room
	Good condition Fair condition ? Requires repair/ replacement
	TYPES AND VISIBLE CONDITIONS OF WATER SUPPLY LINES (limitations in effect)
	Predominant type: Copper piping Galvanized steel ? PEX
	Visible condition: 🗹 Good condition 🔲 Fair condition
	Removal of all galvanized water lines is required to increase water flow and pressure to a desirable level.
	Water pressure: Good water pressure Fair water pressure Poor water pressure
	Functional flow:
	Good functional flow to 2 fixtures when used simultaneously. Basement fixtures excluded.
	Fair functional flow is evident Door functional flow is evident Upgrade of main water service is recommended.
	TYPES AND VISIBLE CONDITIONS OF INTERIOR WASTE/DRAIN LINES
	Predominant type: □ Cast iron/lead □ Copper piping ✓ ABS/plastic □ Galvanized steel Visible are different □ Copper piping ✓ ABS/plastic □ Galvanized steel
	Visible condition: Good condition Fair condition
	✓ No abnormal drainage conditions were observed with all fixtures.
	Repairs required to vent stacks at:
	Replace main cast iron stacks and soil lines upon next renovation to house.
	Repairs required to main drain lines at:
	Clogged slow draining fixtures at:
	Improperly installed fixture drains at:
	Leaking fixture drains at:
	Fixtures with fair functional drainage that appear to be improperly vented:
	BASEMENT/CRAWLSPACE FLOOR DRAIN (visible conditions) ✓ Good condition
	Location not determined Floor drain not installed
	HOT WATER TANK Rental Owned ?
	Energy source: Gas Oil Electric Type: Tank Tankless Combination
	Hot water tank is in: Good condition Fair condition Requires repair/ replacement Old; replace
	Venting condition (gas/oil only): 🗹 Good/ fair condition 🔄 Metal lining recommended
	SUMP PUMP/SEWAGE EJECTOR SYSTEMS Could not test/sump dry/inaccessible/too cold outside
	Condition of sump: Good Fair condition Requires repair/ replacement
	Operation of pump: Good Fair condition Requires repair/ replacement
	Condition of pump discharge: Good Fair condition Requires repair/ replacement Add cover to sump pump
	PRIVATE WATER SOURCE NOTE: Limitations of visual inspection is in effect.
	Type: Pond/stream/spring Well Vault/cistern Location
	Operation of pressure tank: Good Fair condition Requires repair/ replacement
	Operation of (well) pump: Good Fair condition Requires repair/ replacement
	PRIVATE SEWAGE DISPOSAL SYSTEM Image: Constraint of the second secon
	Type: Septic system Holding tank Not determined Location:
	Percolation field free of trees/shrubs: Yes No Not determined Location:
	See Additional Comment Page

1/2-Yr. Priority Ke	y GENERAL INTERIOR ELEMENTS
Maj Min N/A Mor	LIMITATIONS:
Major Repair Minor Repair N/A Monitor Functional	Ve are unable to detect or predict damage to interior finishes as result of slow or intermittent water leaks. Mold
Rep Rep or	detection/indentification and/or analysis is beyond the scope of a visual inspection. Thermal seal failures of
air air	thermalpane glass is beyond our ability to detect or predict.
	WALL & CEILINGS
	Predominant material type: ☐ Plaster & wood lath ☐ Plaster & gypsum lath ☑ Drywall ☐ Wood/paneling
	General condition of surfaces: ☐ Good condition Fair condition Substantial refurbishing recommended/ paint. Most/ some ceilings/ walls are aged; drywalling over existing surfaces is recommended in the near future.
	Repair required at:
	Wall structure type: Wood Steel Masonry & strapping Alternate ceiling type: Suspended/ acoustic tile
	Water stains noted at which were measured dry. Monitoring required.
	FLOOR COVERINGS
	Predominant material type: 🗹 Carpet 🖌 Hardwood 🗌 Wood 💭 Vinyl 🔲 Laminate 🖌 Tile/Stone
	General condition of surfaces: 🗹 No hazardous defects exist(normal wear) 🔲 Substantial refurbishing recommended
	Repair required at:
	 2nd/ 3rd level floor system was not originally intended for habitable use and is presently limited in its ability to support a normal load.
	PRIMARY WINDOW OPERATION/CONDITION
	Function of ventilating windows
	✓ Good condition
	Major refurbishing/ replacement is recommended:
	Window glazing/panes:
	Thermal windows with highly visible defective seals/ condensed panes at:
	Various cracked glass panes are noted. Most/ some panes are single glass only; improvement recommended
	Window handles/locks/hardware:
	Good condition Fair condition Some localized repair/ upgrading/ missing
	All/most operating windows have insect screens. Few/ most insect screens are required to be repaired/ installed
	PRIMARY DOOR OPERATION/CONDITION
	Function of interior doors:
	Good condition Fair condition Minor refitting to most/ some doors
	Door hardware-general conditions:
	✓ Good condition
	STAIRWAYS/RAILINGS & BALCONIES
	Condition of primary staircase(s):
	🗹 Good condition 🗌 Fair condition 🔲 Loose treads/ minor repair 🔲 Major repair/ replacement recommened
	Condition of primary railings/guards:
	Cood condition Fair condition Loose rails/ spindles/ minor repair
	🔲 Installation of safety handrail recommended/ upper flight only 🛛 🔲 Guardrails too low/ spindle spacing unsafe/ missing
	Condition of basement staircase(s):
	🗹 Good condition 🗌 Fair condition 🔲 Loose treads/ minor repair 🗌 Major repair/ replacement recommened
	Condition of basement railings/guards:
	Good condition Fair condition Loose rails/ spindles/ minor repair
	🗌 Installation of safety handrail recommended/ upper flight only 🛛 🗹 Guardrails too low/ spindle spacing unsafe/ missing
	Condition of 3rd floor/supplementary staircase(s):
	Good condition Fair condition Loose treads/ minor repair Major repair/replacement recommened
	Condition of 3rd floor/supplementary railings/guards:
	Good condition Fair condition Loose rails/ spindles/ minor repair
	Installation of safety handrail recommended/ upper flight only Guardrails too low/ spindle spacing unsafe/ missing
	See Additional Comment Page

1/2-Yr. Priority Ke	ATTIC/ROOF SPACES
Maj Min N/A Mon	LIMITATIONS:
Major Rep Minor Rep N/A Monitor Functional	The inspection process cannot predict the ability of the roof stucture to support heavy snow loads.
Major Repair Minor Repair N/A Monitor Functional	Could not access attic due to seized cover/ no attic access/ further review is required prior to proceeding.
	Attic reviewed at hatch access. Floor not walked on. All attic spaces were not fully inspected.
	ACCESSIBILITY
	Good/ fair access to attic Attic floor walked on Attic has lofting potential
	Attic roof space has been converted into living space 🔲 Attic interconnected with adjacent dwelling. Install firewall/fire separation.
	No access to attic is installed Access not required Access to roof spaces/ knee wall spaces is recommended.
	Relocate access Increase size of attic access 🗹 Insulate/ weatherstrip hatch Increase size of attic access Insulate/ weatherstrip hatch Insulate/ weath
	VENTILATION
	Domed roof units Soffit vents Gable/ ridge vents Attic fan(s)/ turbine vents Spaced board sheathing
	Roof vent(s): 🗹 Good condition 🗌 Fair condition 🔲 Repair/ replace roof vents at:
	Additional vents recommended at soffit/ridge area Soffit baffles to be installed in the attic at eaves section.
	INSULATION
	Approx. R-value: □ R0 to R15 (0-5) □ R20 to R28 (6-8) ☑ R32 to R40 (10-12) □ R40+
	Type: ☐ Cellulose fibre ✔ Fibre glass batts/ loose fill ☐ Rock wool ☐ Vermiculite ☐
	Additional insulation recommended to be installed on the attic floor. 🔲 Additional insulation recommended around air ducts.
	Insulation is unevenly distributed on attic floor. Add/ redistribute insulation. Evidence of vapor retarders: No
	ROOF STRUCTURES (where visible)
	Type: 🗹 Rafters/ Collar ties 🔲 Trusses 🔲 Good condition 🗹 Fair condition 🗌 Some localized repairs/ defects
	Additionalcollar ties/ structural support is recommended.
	ROOF BOARDS/SHEATHING (where visible)
	Type: ☐ Plywood ☑ Board sheathing ☐ Good condition ☑ Fair condition
	Probability of replacement of some/ most sheathing with next shingle replacement
	Fair/ poor condition due to inadequate ventilation. Possible mold/ mildew residue developing on sheathing.
	See Additional Comment Page
	KITCHEN
	COUNTER TOP CONDITION
	Counter top is in: Good condition Fair condition Requires repair/ replacement
	Localized damage around faucets; counter replacement is imminent.
	CABINET(S) CONDITION Cabinet condition & operation is in Good condition
	Repairs required to drawers/ door fronts/ shelving/ cabinet mounting.
	STOVE POWER SOURCE ✓ Plug receptacle installed/240V Direct wire connection/no receptacle Gas stove connection T.S.S.A tag required Not visible
	EXTRACTION FAN Exhaust fan is in Good condition Fair condition Repair/ replace fan Installation of exhaust fan recommended
	\mathbf{V} Re-circulating fan is functional \Box Fan is not vented to exterior \Box
	ELECTRICAL RECEPTACLES Good/ fair number of receptacles installed at counter level Ungrounded receptacles(s) in kitchen noted
	Limited number of receptacles in kitchen Additional split duplex receptacles recommended
	SINK/FAUCET CONDITION Sink is in: □ Good condition ✓ Fair condition □ Sink requires repair/ replacement
	Faucet assembly is in \checkmark Good condition \square Fair condition \square Requires repair/ replacement/ new washers/ cartridge
	Garborator is in function condition Repair/ replace garborator
	GENERAL CONDITIONS
	The kitchen is in marginal condition. Major remodelling is recommended in the near future.
	See Additional Comment Page

1/2-Yr. Priority Ke	BATHROOMS
Maj Min N/A Mor Func	LIMITATIONS
Major Rep Minor Rep N/A Monitor Functional	Due to the unpredictable and latent nature of plumbing shower and bathtub enclosure leaks there can be no
Major Repair Minor Repair N/A Monitor Functional	assurances or warranty that leaks will not develop at any time after the inspection date. The development of mold
	is a common result of leaks in the bathroom. We cannot predict or detect damage behind walls.
	SHOWER/BATHTUB ENCLOSURE CONDITION
	The ceramic tile/wall surfaces are in good general condition.
	Sealant and grout touch-ups/ repair required at all/most shower/ bathtub enclosures.
	Shower enclosure exhibits no evidence of leaking but is at the end of expected lifespan at:
	Repair/ replace tile or wall surface at:
	Complete tile and wall replacement required at:
	Repair/install shower door/ curtain assembly at:
	FAUCETS/SHOWER HEAD CONDITION
	Shower faucets/ head assembly are in good/ fair general condition
	✓ Tub faucets are in good/ fair general condition
	Shower faucets/ head assembly requires repair/ replacement at:
	Tub faucet requires repair/ replacement at:
	BATHTUB CONDITION
	Bathtubs are in good/ fair general condition Reglazing/re-lining of bathtub recommended at:
	Bathtubs requires repair/ replacement at:
	Whirlpool bath is functional Whirlpool bath requires repair at:
	Whirlpool bath electrical circuit is required to be protected by an accessible GFCI breaker.
	No access panel/ improper access to mechanical equipment at:
Ç 🛛 🗆 🗖	TOILET CONDITION/BIDET CONDITION
pyrig	✓ Toilets are in good/ fair general condition
Copyright CBCG 2016	Toilet is improperly installed to floor (ie) loose at:
BCC	Bidet in good/ fair general condition Bidet requires repair at:
j 201	WASH BASINS/FAUCET CONDITION & OPERATION
1	✓ Wash basin are in good/ fair general condition.
Jicen	Wash basin requires repair/ replacement at:
sed t	Faucets are in good/ fair general condition. Faucet washers/ cartridge are to be replaced.
o Prz	Faucets require repair/ replace at:
ideer	
o San	Receptacles are in functional condition at all/most bathrooms
naroc	Installation of GFCI receptacle recommended at:
ount	Repair/ replace receptacle at:
	Repair/ relocate light fixture at:
vem	VENTILATION: WINDOWS/EXHAUST FANS
Licensed to Pradeep Samaroo until November 15, 2025	Untilation is provided by a functional window and/or a functional mechanical exhaust fan.
	Repair/ replace exhaust fan at:
)25	✓ Fan not vented to exterior at: Terminates in the attic Could not determine
	Exhaust fan installation recommended at:
	Rework window to provide proper operation/ replace window at
	Window is located in shower enclosure; protection of window is required at:
	SAUNAS/SPAS/STEAMER
	Sauna/ steamer/ hot tub are in good/ fair general condition.
	System/ components require repair/ replacement at:
	GENERAL CONDITIONS
	The bathroom is in marginal condition. Major remodelling is recommended in the near future.

1/2-Yr. Priority Ke	y FIREPLACES
Maj Min N/A Mon	LIMITATIONS:
Major Repair Minor Repair N/A Monitor Functional	Inspecting condition of flue and ability of fireplace to draw is beyond scope of visual inspection. Camera inspection of flue is rec'd.
epair epair	FIREPLACE TYPE
	Masonry fireplace at:
	Wood-burning stove at:
	Factory-built fireplace at: Direct vented gas heater in dining area
	Wood/ coal insert at:
	Gas fireplace at: TSSA inspection tag missing. Further review required.
	FIREPLACE CONDITION
	Combustion chamber is in good/ fair condition.
	Hearth extension is in good/ fair general condition Smoke chamber is in good/ fair general condition.
	Combustion chamber requires repair at:
	Damper requires repair/ replacement at:
	Hearth floor requires repair/ extending at:
	Smoke chamber requires repair at:
	Note: Basement fireplace may not draw properly. Alternativerepair/ improvement strategy recommended
	Flue cleaning recommended at:
	Roughed-in fireplace installed at:
	Non-combustible base/lateral clearances from combustible materials of wood burning stoves.
	Good condition Fair condition W.E.T.T inspection/ camera inspection of flue recommended.
	Improvement required at:
	Do not use fireplace until certified as safe.
	LAUNDRY ROOM
	CLOTHES DRYER CONNECTIONS
	Power source: 🗹 Plug receptacle 240 V 🗌 Direct wire; no plug 📄 No electrical connections 📄 Gas dryer connection 📄 Not visible
	Dryer venting: 🗌 Properly vented to the exterior. 🔲 Duct/ vent requires repair/ cleaning/ repair at exterior 📝 No venting installed
	Replace with metal duct. Vented through window; rework.
	WASHING MACHINE CONNECTIONS
	Power source: Plug receptacle available & properly grounded. No plug receptacle installed/replace receptacle.
	Water connections: Satisfactory connections/ shut off valve.
	Connections require repair/ replacement/ relocating. Replace connection hoses with steel braided lines
	LAUNDRY TUB/FAUCETS Installation recommended
	Tub is in: Good condition Fair condition Tub requires repair/ replacement
	Faucet is in: Good condition Fair condition Faucet requires repair/ replacement New washers required
	EJECTOR PUMP FOR LAUNDRY TUB Good condition Fair condition Pump requires repair/ replacement
	FURTHER INQUIRIES TO SELLER OF PROPERTY
	Ask seller for any manufacturer's warranties or service contracts for appliances and equipment and recent home improvements.
	Ask seller for plans/drawings/project documentation and permits for any improvements to the property.
	Ask seller for list of tradespeople and service technicians who have worked on the property.
	Inquire to seller about cause of water stain on ceiling/ wall.

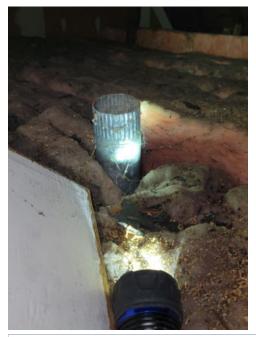

Washroom exhaust vent terminates in the attic